




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: ANDAZA_ST Cross Street: ANDAZA_ST Location: S

ADA ID: CCRK211202135938 Curb Cut Type: MedianRefuge2 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 17.5

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

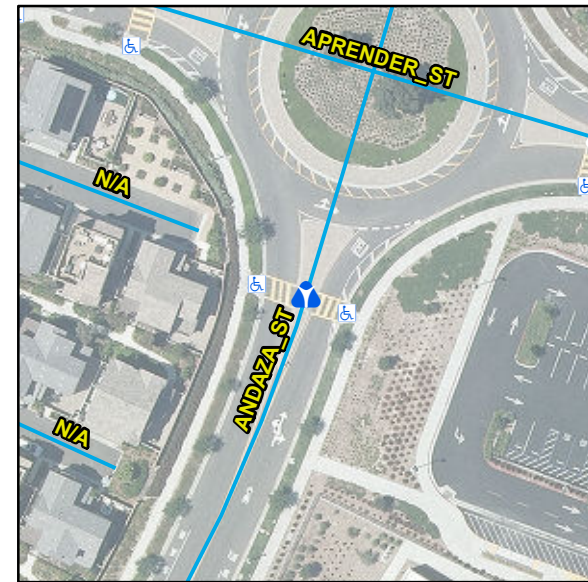

Possible Solutions:
**Remove & Replace Detectable Warning System.
Remove & Replace Gutter.**

Surveyor Notes:
N/A

OC Std/PROW:
R305.1.4, R304.5.4, STD 1115

Total Cost: \$ 1304

Parcel ID Number 755-301-37

Street 1 Name ANDAZA_ST
Stop Condition-Street 1 N/A
Street 2 Name ANDAZA_ST
Stop Condition-Street 2 N/A

Google Street View Link
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.53684742,-117.59703941

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	56	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	96	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	1	No	Gutter 1 Slope (%)	5.1
Yes	Refuge 1 Cross Slope (%)	2.1	Yes	Gutter 1 Cross Slope (%)	1.8
N/A	Painted Cross Walk 1	Yes	Yes	DWS 1 Provided	Yes
	Cross Walk 1 Direction	W	Yes	DWS 1 Contrast	Yes
	Cross Walk 1 Width (In)	144	Yes	DWS 1 Length (In)	36
Yes	Refuge Inside Cross Walk 1	Yes	No	DWS 1 Full Width	No
	Road 1 Slope (%)	3.8	Yes	DWS 1 Offset (In)	0
	Road 1 Cross Slope (%)	2.1			N/A
Yes	Refuge 2 Length (In)	57	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	96	Yes	Gutter 2 Lip Ht (In)	0
Yes	Refuge 2 Slope (%)	0.9	No	Gutter 2 Slope (%)	5.1
Yes	Refuge 2 Cross Slope (%)	2.1	Yes	Gutter 2 Cross Slope (%)	0.5
N/A	Painted Cross Walk 2	Yes	Yes	DWS 2 Provided	Yes
	Cross Walk 2 Direction	E	Yes	DWS 2 Contrast	Yes
	Cross Walk 2 Width (In)	144	Yes	DWS 2 Length (In)	36
Yes	Refuge Inside Cross Walk 2	Yes	Yes	DWS 2 Full Width	Yes
	Road 2 Slope (%)	3.5	Yes	DWS 2 Offset (In)	0
	Road 2 Cross Slope (%)	0.5			
Yes	Overall Surface Condition:	Acceptable			

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

