




Access Compliance Report Public Rights-of-Way (Island Curb Cuts)



Main Street: AIROSO_ST		Cross Street: ANDAZA_ST		Location:	SW
ADA ID: CCRK211203115518	Curb Cut Type: MedianRefuge2	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	15
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

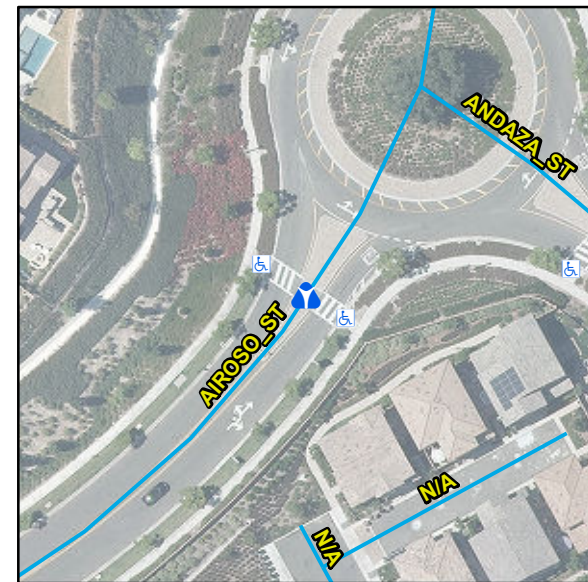

Possible Solutions:

Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R302.7.2, STD 1115

Total Cost:

\$ 150

Parcel ID Number

755-572-67

Street 1 Name

AIROSO_ST

Stop Condition-Street 1

N/A

Street 2 Name

ANDAZA_ST

Stop Condition-Street 2

N/A

Google Street View Link

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54227073,-117.59599178

Compliance	Description	Data	Compliance	Description	Data
Yes	Refuge 1 Length (In)	53	Yes	Guttter 1 Ponding	No
Yes	Refuge 1 Width (In)	63	Yes	Gutter 1 Lip Ht (In)	0
Yes	Refuge 1 Slope (%)	1.3	Yes	Gutter 1 Slope (%)	2.3
Yes	Refuge 1 Cross Slope (%)	3.3	Yes	Gutter 1 Cross Slope (%)	2.8
N/A	Painted Cross Walk 1	Yes	Yes	DWS 1 Provided	Yes
	Cross Walk 1 Direction	NW	Yes	DWS 1 Contrast	Yes
	Cross Walk 1 Width (In)	144	Yes	DWS 1 Length (In)	36
Yes	Refuge Inside Cross Walk 1	Yes	Yes	DWS 1 Full Width	Yes
	Road 1 Slope (%)	3.2	Yes	DWS 1 Offset (In)	0
	Road 1 Cross Slope (%)	1.3			N/A
Yes	Refuge 2 Length (In)	53	Yes	Guttter 2 Ponding	No
Yes	Refuge 2 Width (In)	63	No	Gutter 2 Lip Ht (In)	1
Yes	Refuge 2 Slope (%)	1.3	Yes	Gutter 2 Slope (%)	3.2
Yes	Refuge 2 Cross Slope (%)	3.3	Yes	Gutter 2 Cross Slope (%)	0.7
N/A	Painted Cross Walk 2	Yes	Yes	DWS 2 Provided	Yes
	Cross Walk 2 Direction	SE	Yes	DWS 2 Contrast	Yes
	Cross Walk 2 Width (In)	144	Yes	DWS 2 Length (In)	36
Yes	Refuge Inside Cross Walk 2	Yes	Yes	DWS 2 Full Width	Yes
	Road 2 Slope (%)	0.7	Yes	DWS 2 Offset (In)	0
	Road 2 Cross Slope (%)	1			
Yes	Overall Surface Condition: Acceptable				

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

