



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: ANDORA_DR Cross Street: FAIRHOPE_DR Location: N

ADA ID: RPAT210921082007 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 9

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

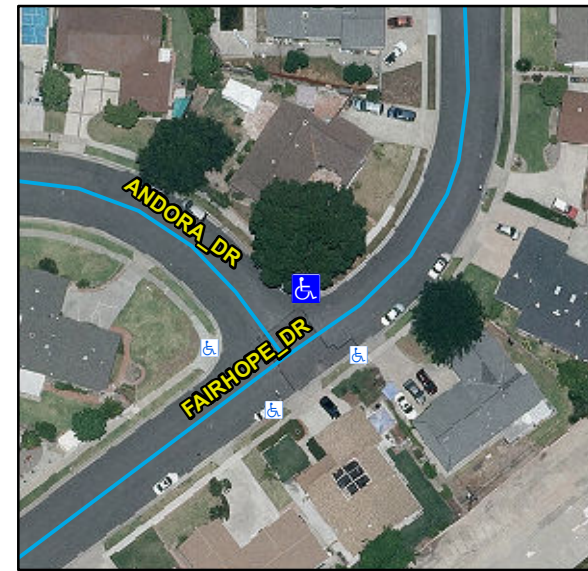

Possible Solutions:

Remove & Replace Landing. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R304.5.4, STD 1115

Total Cost: \$ 783

Parcel ID Number 066-362-27 Street 1 Name ANDORA_DR
Ramp Island Or Median None Stop Condition-Street 1 NoControl
Ramp Orientation Diag Street 2 Name FAIRHOPE_DR
Google Street View Link: Stop Condition-Street 2 NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.89464919,-117.99037751

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	65	N/A	Ramp Length RT (in)	77
Yes	Ramp Width LT (in)	99	Yes	Ramp Width RT (in)	101
Yes	Ramp Run Slope LT (%)	5.5	Yes	Ramp Run Slope RT (%)	7.7
Yes	Ramp Cross Slope LT (%)	1.4	Yes	Ramp Cross Slope RT (%)	1.4
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	97	Yes	DWS Contrast	Yes
No	Landing Width (in)	46	Yes	DWS Length (in)	38
Yes	Landing Run Slope (%)	1.5	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.4		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SW		Crossing 2 Direction	SE
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.9		Crossing 2 Slope (%)	9.3
	Crossing 1 Cross Slope (%)	5.1		Crossing 2 Cross Slope (%)	1.3
Yes	Gutter Ponding	No	Yes	Curb Slope	1.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.3
No	Gutter Run Slope (%)	10.2		Road Cross Slope (%)	5.1
Yes	Gutter Cross Slope (%)	0.5	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A