



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **STANTON_AVE** Cross Street: **ASHGROVE_DR** Location: **NE**

ADA ID: **RPAT210921102931** Ramp Type: **Type 1 - Perpendicular Diagonal** Initial Pass/Fail: **Pass** Overall Compliance: **No** Severity Score: **22**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

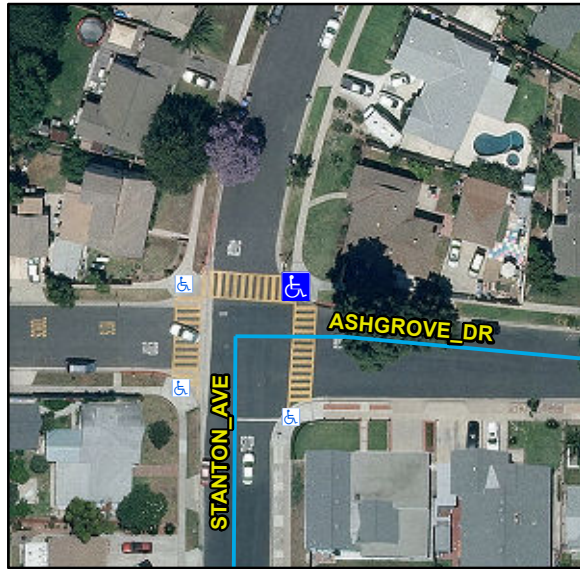

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Grind Gutter Lip.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R304.5.3, R304.2.3, R302.7.2, STD 1115

Total Cost: \$ **6310**

Parcel ID Number: **066-361-01**
 Ramp Island Or Median: **None**
 Ramp Orientation: **Diag**
 Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.89560584,-117.99405728

Street 1 Name: **STANTON_AVE**
 Stop Condition-Street 1: **StopSign**
 Street 2 Name: **ASHGROVE_DR**
 Stop Condition-Street 2: **StopSign**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	97	N/A	Flare Type LT	
Yes	Ramp Width (in)	48		Flare Slope LT (%)	14.8
Yes	Ramp Run Slope (%)	8	No	Flare Traversable LT	Yes
Yes	Ramp Cross Slope (%)	1.4	N/A	Flare Type RT	
N/A	Landing Present	Yes		Flare Slope RT (%)	5.1
N/A	Landing Length (in)	34		Flare Traversable RT	No
Yes	Landing Width (in)	67	N/A	DWS Provided	Yes
Yes	Landing Run Slope (%)	1	Yes	DWS Contrast	Yes
No	Landing Cross Slope (%)	2.6	Yes	DWS Length (in)	36
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Full Width	Yes
	Landing Movement Type	Curb	Yes	DWS Offset Left (in)	0
N/A	Landing Shared	No	Yes	DWS Offset Right (in)	N/A
Yes	Clear Space	Yes	N/A	Marked Crosswalk 2	Yes
Yes	Clear Space To Crosswalk (in)	48		Crossing 1 Direction	W
N/A	Marked Crosswalk 1	Yes		Crossing 2 Direction	S
	Crossing 1 Width (in)	167		Marked Crosswalk 2 Width (in)	167
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	7.1		Crossing 2 Slope (%)	4.6
	Crossing 1 Cross Slope (%)	1.9		Crossing 2 Cross Slope (%)	4.4
Yes	Gutter Ponding	No	Yes	Curb Slope	1.6
No	Gutter Lip Height (in)	2		Road Run Slope (%)	2.7
Yes	Gutter Run Slope (%)	4		Road Cross Slope (%)	9.2
Yes	Gutter Cross Slope (%)	1.6			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

