



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: FAIRHOPE_DR		Cross Street: STANTON_AVE		Location:	SE
ADA ID: RPAT210921124546	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	6
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Landing. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.5.4, STD 1115


Total Cost: \$ 783

Parcel ID Number	066-373-14	Street 1 Name	FAIRHOPE_DR
Ramp Island Or Median	None	Stop Condition-Street 1	StopSign
Ramp Orientation	Diag	Street 2 Name	STANTON_AVE
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.89171357,-117.99403235

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

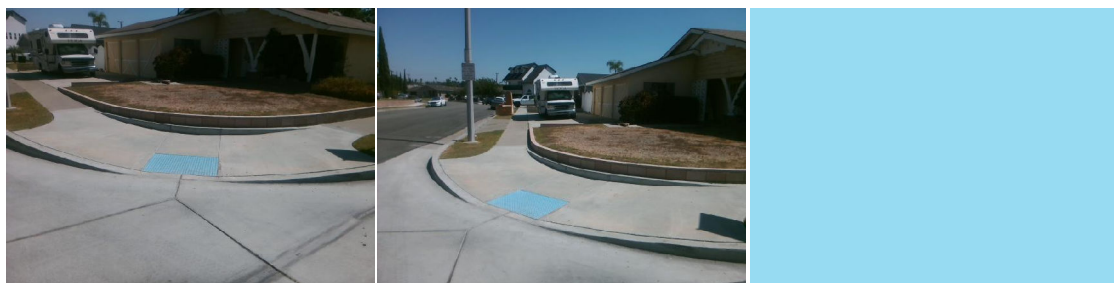

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	112	N/A	Ramp Length RT (in)	115
Yes	Ramp Width LT (in)	103	Yes	Ramp Width RT (in)	104
Yes	Ramp Run Slope LT (%)	8.1	Yes	Ramp Run Slope RT (%)	4.7
Yes	Ramp Cross Slope LT (%)	1.5	Yes	Ramp Cross Slope RT (%)	0.5
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	101	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.6	Yes	DWS Full Width	Yes
No	Landing Cross Slope (%)	2.1		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	1.5		Crossing 2 Slope (%)	6.3
	Crossing 1 Cross Slope (%)	2.9		Crossing 2 Cross Slope (%)	0.1
Yes	Gutter Ponding	No	Yes	Curb Slope	2.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1
No	Gutter Run Slope (%)	5.4		Road Cross Slope (%)	1.3
Yes	Gutter Cross Slope (%)	0.7	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No