



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: KELLOGG_DR		Cross Street: OLD_RANCH_RD		Location:	SE
ADA ID: RPAT210922095236	Ramp Type: Type 3 - Combination 1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	19
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.5.1, R304.3.2, STD 1115


Total Cost: \$ 6160

Parcel ID Number	348-042-17	Street 1 Name	KELLOGG_DR
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	OLD_RANCH_RD
Google Street View Link:		Stop Condition-Street 2	StopSign

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.88322274,-117.79687595

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

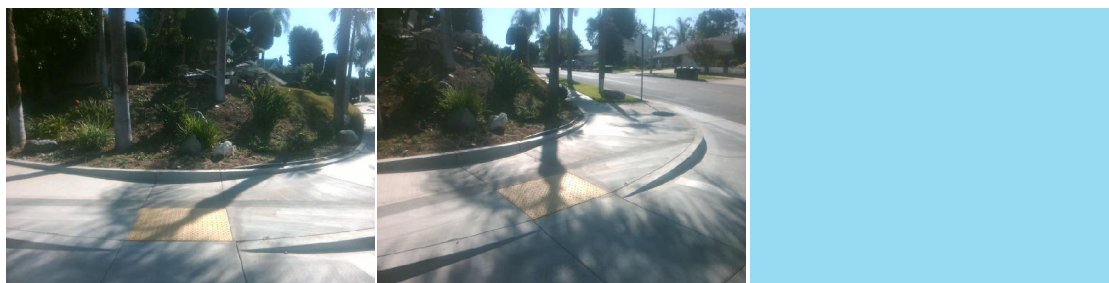

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	111	N/A	Ramp Length RT (in)	83
No	Ramp Width LT (in)	45	Yes	Ramp Width RT (in)	50
No	Ramp Run Slope LT (%)	8.6	Yes	Ramp Run Slope RT (%)	2.4
Yes	Ramp Cross Slope LT (%)	1.8	Yes	Ramp Cross Slope RT (%)	0.7
N/A	Ramp Length (in)	50	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
Yes	Ramp Run Slope (%)	0.2	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.8	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes		DWS Offset Type	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Left (in)	N/A
			N/A	DWS Offset Right (in)	N/A
Yes	Perp Joint Present	Yes			
	Parallel Ramp Side	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5		Crossing 2 Slope (%)	11.1
	Crossing 1 Cross Slope (%)	6.6		Crossing 2 Cross Slope (%)	0.3
N/A	Gutter Ponding	N/A	No	Curb Slope	10
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.7
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	3.5
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition:	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No