



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: **KELLOGG_DR** Cross Street: **MOUNTAIN_VIEW_AVE** Location: **E**

ADA ID: **RPAT210922123233** Ramp Type: **Type 4 - Parallel** Initial Pass/Fail: **Pass** Overall Compliance: **No** Severity Score: **0**

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance



Possible Solutions:
Remove & Replace Curb Slope.

Surveyor Notes:
N/A

OC Std/PROW:
R304.2.2, STD 1115


Total Cost: \$ **252**

Parcel ID Number **348-104-03** Street 1 Name **KELLOGG_DR**
Ramp Island Or Median **None** Stop Condition-Street 1 **Signal**
Ramp Orientation **Diag** Street 2 Name **MOUNTAIN_VIEW_AVE**
Google Street View Link: Stop Condition-Street 2 **Signal**

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.88032803,-117.79983668

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

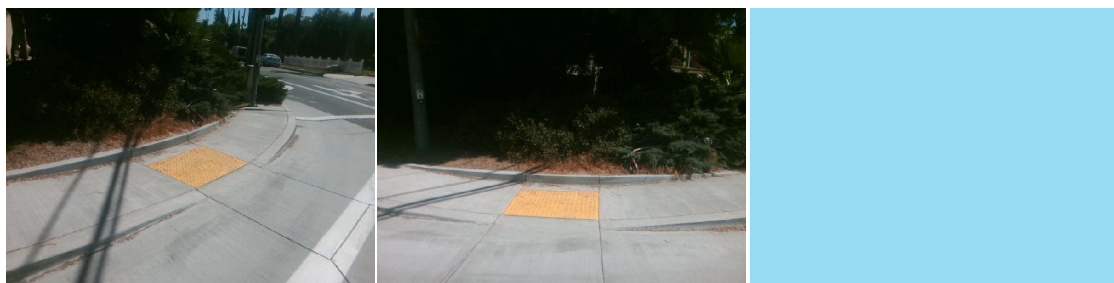

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	112	N/A	Ramp Length RT (in)	107
Yes	Ramp Width LT (in)	48	Yes	Ramp Width RT (in)	48
Yes	Ramp Run Slope LT (%)	5.9	Yes	Ramp Run Slope RT (%)	6.4
Yes	Ramp Cross Slope LT (%)	0.6	Yes	Ramp Cross Slope RT (%)	0.5
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	48	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.8	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	1.6		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
Yes	Clear Space	Yes			
Yes	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NW		Crossing 2 Direction	SW
	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	120
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	2		Crossing 2 Slope (%)	4.8
	Crossing 1 Cross Slope (%)	2.2		Crossing 2 Cross Slope (%)	2.2
Yes	Gutter Ponding	No	No	Curb Slope	9.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.5
Yes	Gutter Run Slope (%)	3.7		Road Cross Slope (%)	4.2
Yes	Gutter Cross Slope (%)	0.1	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No