



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: SHADOW_HILL_DR Cross Street: KELLOGG_DR Location: NW

ADA ID: RPAT210922133553 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 46

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

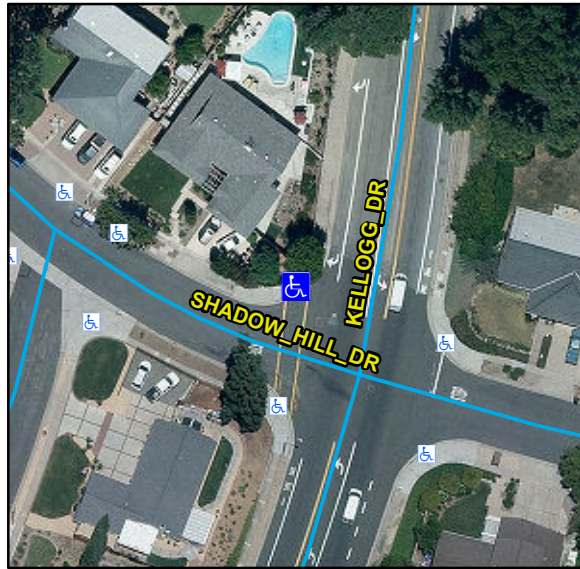

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.2.1, R304.2.3, R304.5.4, STD 1115

Total Cost: \$ 6412

Parcel ID Number 348-061-01
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

Street 1 Name SHADOW_HILL_DR
Stop Condition-Street 1 StopSign
Street 2 Name KELLOGG_DR
Stop Condition-Street 2 NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.88521279,-117.7956769

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	44	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	0	Yes	Flare Slope LT (%)	8
No	Ramp Cross Slope (%)	10.8	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	43			Sloped
Yes	Landing Width (in)	48	No	Flare Slope RT (%)	11.6
Yes	Landing Run Slope (%)	1.7	N/A	Flare Traversable RT	Yes
No	Landing Cross Slope (%)	10.2	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	Yes	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5		Crossing 2 Slope (%)	9.2
	Crossing 1 Cross Slope (%)	13.9		Crossing 2 Cross Slope (%)	3.3
Yes	Gutter Ponding	No	N/A	Curb Slope	1.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	9.5
No	Gutter Run Slope (%)	5.6		Road Cross Slope (%)	5.8
No	Gutter Cross Slope (%)	8.4			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

