




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CRESTKNOLL_DR **Cross Street:** LARKRIDGE_DR **Location:** SE

ADA ID: RPAT210923094114 **Ramp Type:** Type 3 - Combination 1 **Initial Pass/Fail:** Fail **Overall Compliance:** No **Severity Score:** 16

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

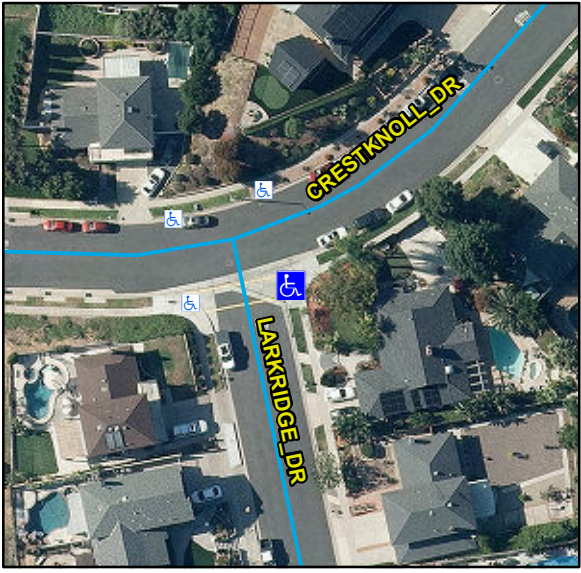

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
 N/A

OC Std/PROW:
 R304.2.2, R304.5.3, R304.3.2, STD 1115

Total Cost: \$ 6160

Parcel ID Number: 349-022-07
Ramp Island Or Median: None
Ramp Orientation: Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.86939927,-117.79022261

Street 1 Name: CRESTKNOLL_DR
Stop Condition-Street 1: NoControl
Street 2 Name: LARKRIDGE_DR
Stop Condition-Street 2: StopSign

Obstruction and Utility Measurement/Component Compliance			
Compliance	Description	Data	
Yes	Obstructions Present?	No	N/A
	Obstruction Types	N/A	
	Obstruction Dimensions	N/A	
	Utilities Present?	No	
	Utility Types		N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	88	N/A	Ramp Length RT (in)	75
Yes	Ramp Width LT (in)	48	Yes	Ramp Width RT (in)	50
No	Ramp Run Slope LT (%)	11.9	No	Ramp Run Slope RT (%)	8.7
No	Ramp Cross Slope LT (%)	3.3	Yes	Ramp Cross Slope RT (%)	0.9
N/A	Ramp Length (in)	46	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
No	Ramp Run Slope (%)	8.6	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	2.4	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes		DWS Offset Type	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Left (in)	N/A
			N/A	DWS Offset Right (in)	N/A
Yes	Perp Joint Present	Yes			
	Parallel Ramp Side	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	120
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	6.9		Crossing 2 Slope (%)	7.3
	Crossing 1 Cross Slope (%)	7.9		Crossing 2 Cross Slope (%)	0.8
N/A	Gutter Ponding	N/A	No	Curb Slope	17.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.3
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	3
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition:	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

