




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CRESTKNOLL_DR	Cross Street: FAIRLYNN_BLVD	Location:	SE
----------------------------	-----------------------------	-----------	----

ADA ID: RPAT210923094940	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	16
--------------------------	------------------------------	-------------------------	------------------------	-----------------	----

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

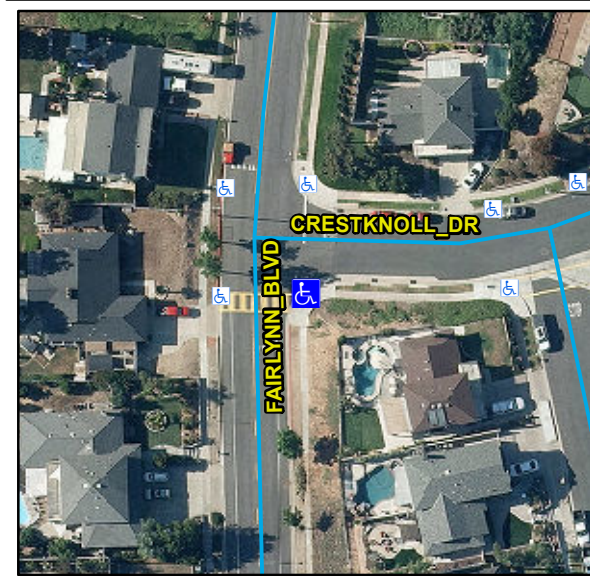

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.3.2, STD 1115

Total Cost: \$ 4000

Parcel ID Number	349-023-01	Street 1 Name	CRESTKNOLL_DR
Ramp Island Or Median	None	Stop Condition-Street 1	StopSign
Ramp Orientation	Diag	Street 2 Name	FAIRLYNN_BLVD
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.86935886,-117.79076638

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	56	N/A	Ramp Length RT (in)	55
Yes	Ramp Width LT (in)	98	Yes	Ramp Width RT (in)	104
Yes	Ramp Run Slope LT (%)	8.1	No	Ramp Run Slope RT (%)	9.9
No	Ramp Cross Slope LT (%)	3.3	Yes	Ramp Cross Slope RT (%)	0.2
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	120
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	2		Crossing 2 Slope (%)	2.1
	Crossing 1 Cross Slope (%)	0.8		Crossing 2 Cross Slope (%)	1.6
N/A	Gutter Ponding	N/A	N/A	Curb Slope	3.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.4
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A