




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: OAKVALE_DR Cross Street: FAIRLYNN_BLVD Location: SE

ADA ID: RPAT210923102713 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 15

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

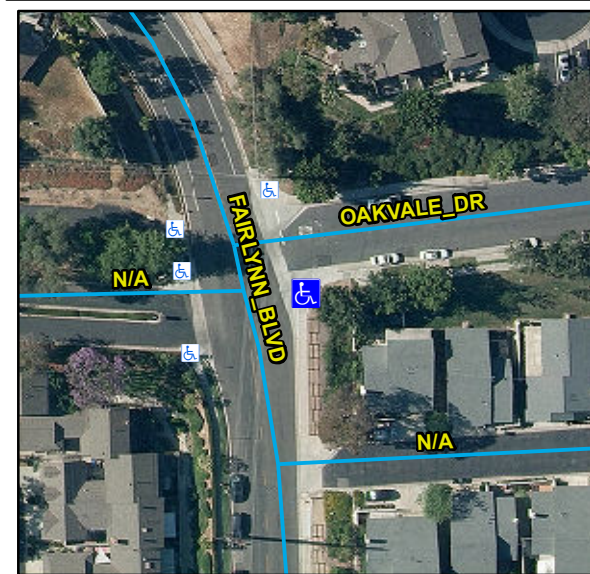

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A

OC Std/PROW:
R304.3.2, STD 1115


Total Cost: \$ 4000

Parcel ID Number	349-411-01	Street 1 Name	OAKVALE_DR
Ramp Island Or Median	None	Stop Condition-Street 1	StopSign
Ramp Orientation	Diag	Street 2 Name	FAIRLYNN_BLVD
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.86624976,-117.78630281

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

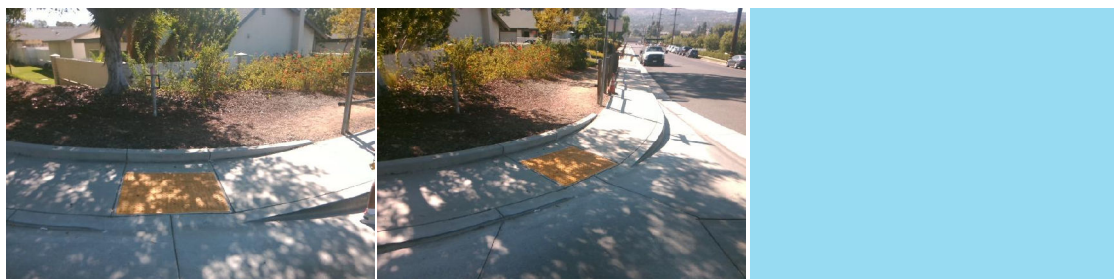

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	121	N/A	Ramp Length RT (in)	82
Yes	Ramp Width LT (in)	51	Yes	Ramp Width RT (in)	53
No	Ramp Run Slope LT (%)	10.9	Yes	Ramp Run Slope RT (%)	2.2
Yes	Ramp Cross Slope LT (%)	1.3	Yes	Ramp Cross Slope RT (%)	0.5
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5.7		Crossing 2 Slope (%)	5.65
	Crossing 1 Cross Slope (%)	5.8		Crossing 2 Cross Slope (%)	5.7
N/A	Gutter Ponding	N/A	N/A	Curb Slope	8.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	5.3
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.1
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No