



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: N_SKYWOOD_ST Cross Street: BIXBY_AVE Location: NE

ADA ID: RPAT210924124726 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 50

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

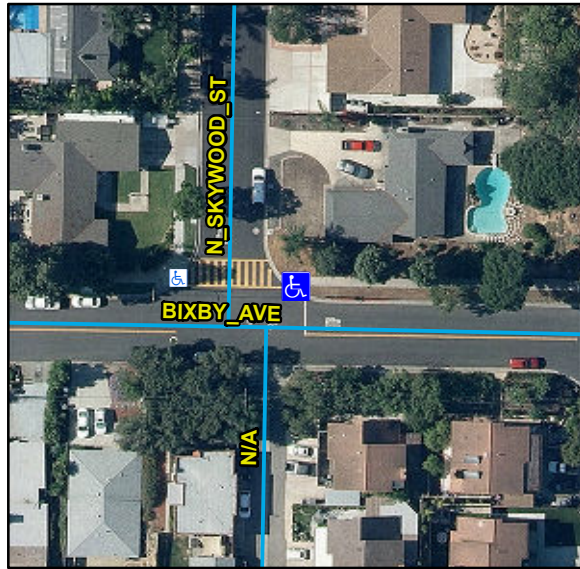

Possible Solutions:

Remove & Replace Entire Ramp. Restripe Crosswalk. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.5.2, R305, R207.1, R304.5.4, STD 1115

Total Cost: \$ 7332

Parcel ID Number 360-332-06
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

Street 1 Name N_SKYWOOD_ST
Stop Condition-Street 1 StopSign
Street 2 Name BIXBY_AVE
Stop Condition-Street 2 N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.83899659,-117.84297668

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	102	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			None
No	Ramp Run Slope (%)	23.5	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0	N/A	Flare Traversable LT	N/A
No	Grade Break	No	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			Sloped
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	No
	Addl Para Ramp Right?	No	No	DWS Provided	No
N/A	Landing Present	No	N/A	DWS Contrast	N/A
No	Landing Length (in)	N/A	N/A	DWS Length (in)	N/A
No	Landing Width (in)	N/A	N/A	DWS Full Width	N/A
No	Landing Run Slope (%)	N/A		DWS Offset Type	N/A
No	Landing Cross Slope (%)	N/A	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Clear Space	N/A
	Crossing 1 Direction	W	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	120			
No	Ramp Inside Crosswalk 1	No			
	Crossing 1 Slope (%)	11.3			
	Crossing 1 Cross Slope (%)	11			
Yes	Gutter Ponding	No	N/A	Curb Slope	15.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	-9999		Road Cross Slope (%)	N/A
No	Gutter Cross Slope (%)	-9999		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

