



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: ORANGE_OLIVE_RD Cross Street: E_WHITECAP_AVE Location: NE

ADA ID: RPAT210924142603 Ramp Type: Type 3 - Combination 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

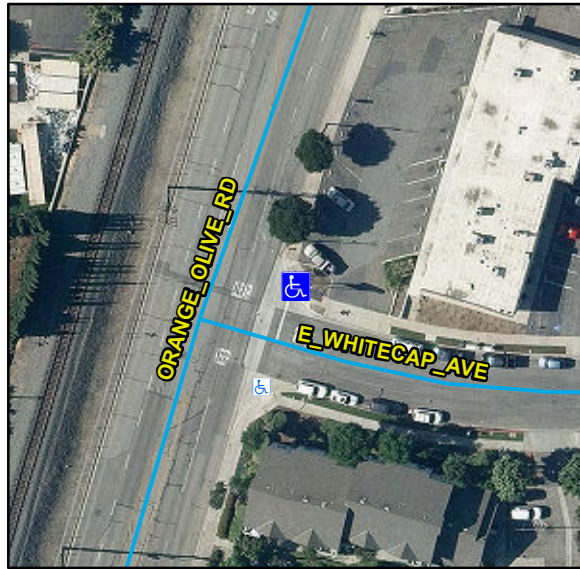

Possible Solutions:

Remove & Replace Curb Slope.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, STD 1115

Total Cost: \$ 252

Parcel ID Number 374-491-31
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.8352898,-117.84650601

Street 1 Name ORANGE_OLIVE_RD
Stop Condition-Street 1 NoControl
Street 2 Name E_WHITECAP_AVE
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	89	N/A	Ramp Length RT (in)	79
Yes	Ramp Width LT (in)	51	Yes	Ramp Width RT (in)	54
Yes	Ramp Run Slope LT (%)	3.8	Yes	Ramp Run Slope RT (%)	3.5
Yes	Ramp Cross Slope LT (%)	0.1	Yes	Ramp Cross Slope RT (%)	0.1
N/A	Ramp Length (in)	42	N/A	Flare Type LT	
Yes	Ramp Width (in)	50			Sloped
Yes	Ramp Run Slope (%)	6.5	N/A	Flare Slope LT (%)	6.2
Yes	Ramp Cross Slope (%)	0.5	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
Yes	Landing Length (in)	50			Sloped
Yes	Landing Width (in)	50	N/A	Flare Slope RT (%)	8.1
Yes	Landing Run Slope (%)	0.9	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	0.4	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	N/A		DWS Offset Type	Single
N/A	Clear Space To Crosswalk (in)	N/A	Yes	DWS Offset Left (in)	0
			Yes	DWS Offset Right (in)	N/A
Yes	Perp Joint Present	Yes			
	Parallel Ramp Side	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	S		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	2.4		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	No	Curb Slope	8.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	2.9		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.2			
Yes	Overall Surface Condition: Acceptable				
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

