




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: **E_WHITECAP_AVE** Cross Street: **ORANGE_OLIVE_RD** Location: **SE**

ADA ID: **RPAT210924143039** Ramp Type: **Type 1 - Perpendicular** Initial Pass/Fail: **Pass** Overall Compliance: **No** Severity Score: **0**

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

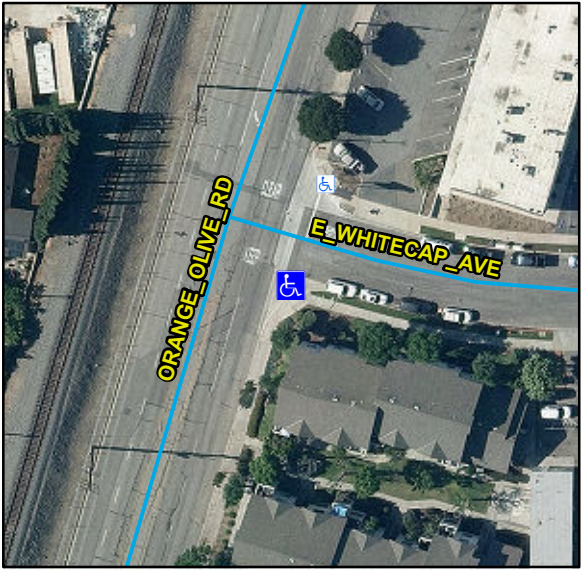

Possible Solutions:
Remove & Replace Entire Ramp.

Surveyor Notes:
N/A

OC Std/PROW:
R304.2.2, R304.2.1, STD 1115

Total Cost: **\$ 3080**

Parcel ID Number: **374-492-02**
 Ramp Island Or Median: **None**
 Ramp Orientation: **NonDiag**
 Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.83514479,-117.84656288

Street 1 Name: **E_WHITECAP_AVE**
 Stop Condition-Street 1: **NoControl**
 Street 2 Name: **ORANGE_OLIVE_RD**
 Stop Condition-Street 2: **N/A**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	41	N/A	Flare Type LT	
Yes	Ramp Width (in)	49		Flare Slope LT (%)	Sloped
Yes	Ramp Run Slope (%)	7.6	N/A	Flare Traversable LT	8.4
Yes	Ramp Cross Slope (%)	2	N/A	Flare Type RT	No
N/A	Landing Present	Yes		Flare Slope RT (%)	Sloped
N/A	Landing Length (in)	50		Flare Traversable RT	Yes
Yes	Landing Width (in)	48	Yes	DWS Provided	Yes
Yes	Landing Run Slope (%)	1	N/A	DWS Contrast	Yes
Yes	Landing Cross Slope (%)	1.4	Yes	DWS Length (in)	36
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Full Width	Yes
	Landing Movement Type	Curb	Yes	DWS Offset Left (in)	0
N/A	Landing Shared	No	Yes	DWS Offset Right (in)	N/A
N/A	Clear Space	N/A	Yes	Marked Crosswalk 1	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	Crossing 1 Direction	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Width (in)	N/A		Crossing 1 Slope (%)	1.7
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Crossing 1 Cross Slope (%)	2.3
	Crossing 2 Width (in)	N/A	No	Gutter Ponding	No
	Crossing 2 Slope (%)	N/A	No	Gutter Lip Height (in)	0
	Crossing 2 Cross Slope (%)	N/A	Yes	Gutter Run Slope (%)	3.8
Yes	Gutter Ponding	No	No	Gutter Cross Slope (%)	1.6
Yes	Gutter Lip Height (in)	0		Overall Surface Condition: Acceptable	Yes
Yes	Gutter Run Slope (%)	3.8		Cross Gutter Present?	Yes
Yes	Gutter Cross Slope (%)	1.6		Replace Cross Gutter?	No
	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Replace Cross Gutter?	No		Spandrel Present?	Yes
				Replace Spandrel?	No

