



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: MAIN_ST Cross Street: N_ORANGE_OLIVE_RD Location: SE

ADA ID: RPAT210924143731 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

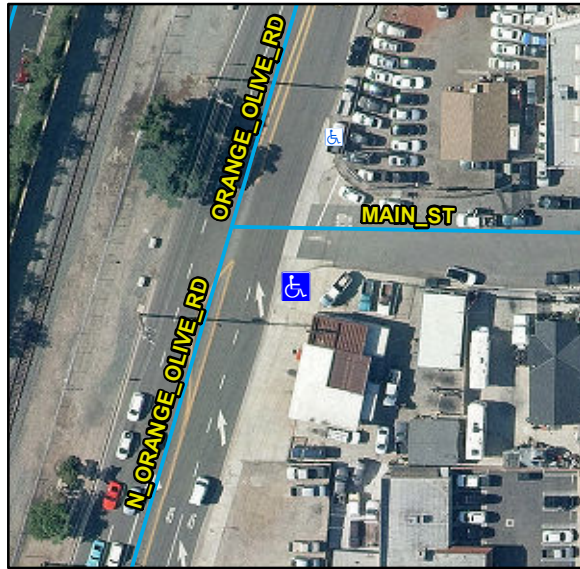

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.2, R304.2.3, R304.5.4, R304.5.3, STD 1115

Total Cost: \$ 3332

Parcel ID Number 360-385-05
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.8368467,-117.84593206

Street 1 Name MAIN_ST
Stop Condition-Street 1 StopSign
Street 2 Name N_ORANGE_OLIVE_RD
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	149	No	Flare Type LT	
Yes	Ramp Width (in)	51			Curbed1
Yes	Ramp Run Slope (%)	4.5	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.6	N/A	Flare Traversable LT	N/A
No	Grade Break	No	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			Sloped
N/A	Grade Break Cross Slope (%)	N/A	Yes	Flare Slope RT (%)	4.5
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	Yes
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
Yes	Landing Length (in)	61	Yes	DWS Length (in)	36
Yes	Landing Width (in)	90	Yes	DWS Full Width	Yes
Yes	Landing Run Slope (%)	2		DWS Offset Type	Multiple
Yes	Landing Cross Slope (%)	0.2	Yes	DWS Left Offset (in)	50
N/A	Landing Movement Obstructed?	No	Yes	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	N	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	2.8			
	Crossing 1 Cross Slope (%)	0.2			
Yes	Gutter Ponding	No	Yes	Curb Slope	7.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	10.5		Road Cross Slope (%)	N/A
No	Gutter Cross Slope (%)	2.8		Parallel Ramp Side	Left
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

