




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



|                                         |                                  |                         |                                         |                 |    |
|-----------------------------------------|----------------------------------|-------------------------|-----------------------------------------|-----------------|----|
| Main Street: N_ESPLANADE_ST             |                                  | Cross Street: SPRING_ST |                                         | Location:       | NW |
| ADA ID: RPAT210927113410                | Ramp Type:Type 1 - Perpendicular | Initial Pass/Fail: Fail | Overall Compliance: No                  | Severity Score: | 32 |
| Codes/Mitigation Info/Possible Solution |                                  |                         | Field Measurements/Component Compliance |                 |    |

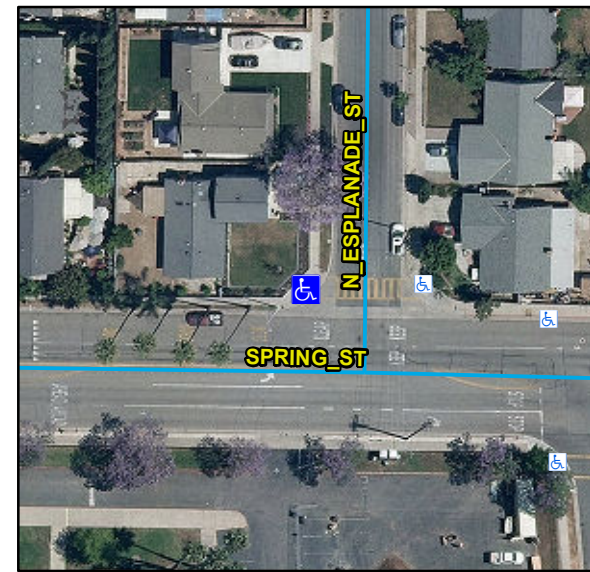

Possible Solutions:

**Remove & Replace Entire Ramp. Restripe Crosswalk.**

Surveyor Notes:

N/A

OC Std/PROW:

**R304.2.2, R304.5.3, STD 1115**

Total Cost: \$ 7080

|                          |            |                         |                |
|--------------------------|------------|-------------------------|----------------|
| Parcel ID Number         | 093-394-10 | Street 1 Name           | N_ESPLANADE_ST |
| Ramp Island Or Median    | None       | Stop Condition-Street 1 | StopSign       |
| Ramp Orientation         | NonDiag    | Street 2 Name           | SPRING_ST      |
| Google Street View Link: |            | Stop Condition-Street 2 | N/A            |

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.79153491,-117.81015593](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79153491,-117.81015593)

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |



| Compliance | Description                           | Data | Compliance | Description                   | Data |
|------------|---------------------------------------|------|------------|-------------------------------|------|
| N/A        | Ramp Length (in)                      | 75   | N/A        | Flare Type LT                 |      |
| Yes        | Ramp Width (in)                       | 51   |            |                               | N/A  |
| No         | Ramp Run Slope (%)                    | 13.7 | N/A        | Flare Slope LT (%)            | N/A  |
| No         | Ramp Cross Slope (%)                  | 4.2  | N/A        | Flare Traversable LT          | N/A  |
| N/A        | Landing Present                       | N/A  | N/A        | Flare Type RT                 |      |
| N/A        | Landing Length (in)                   | N/A  |            |                               | N/A  |
| N/A        | Landing Width (in)                    | N/A  | N/A        | Flare Slope RT (%)            | N/A  |
| N/A        | Landing Run Slope (%)                 | N/A  | N/A        | Flare Traversable RT          | N/A  |
| N/A        | Landing Cross Slope (%)               | N/A  | N/A        | DWS Provided                  | N/A  |
| N/A        | Landing Movement Obstructed?          | N/A  | N/A        | DWS Contrast                  | N/A  |
|            | Landing Movement Type                 | N/A  | N/A        | DWS Length (in)               | N/A  |
| N/A        | Landing Shared                        | N/A  | N/A        | DWS Full Width                | N/A  |
| N/A        | Clear Space                           | N/A  | N/A        | DWS Offset Left (in)          | N/A  |
| N/A        | Clear Space To Crosswalk (in)         | N/A  | N/A        | DWS Offset Right (in)         | N/A  |
| N/A        | Marked Crosswalk 1                    | Yes  | N/A        | Marked Crosswalk 2            | N/A  |
|            | Crossing 1 Direction                  | E    |            | Crossing 2 Direction          | N/A  |
|            | Marked Crosswalk 1 Width (in)         | 120  |            | Marked Crosswalk 2 Width (in) | N/A  |
| N/A        | Ramp Inside Crosswalk 1               | No   | Yes        | Ramp Inside Crosswalk 2       | N/A  |
|            | Crossing 1 Slope (%)                  | 2.4  |            | Crossing 2 Slope (%)          | N/A  |
|            | Crossing 1 Cross Slope (%)            | 0.4  |            | Crossing 2 Cross Slope (%)    | N/A  |
| N/A        | Gutter Ponding                        | N/A  | N/A        | Curb Slope                    | 0.2  |
| Yes        | Gutter Lip Height (in)                | 0    |            | Road Run Slope (%)            | N/A  |
| N/A        | Gutter Run Slope (%)                  | N/A  |            | Road Cross Slope (%)          | N/A  |
| N/A        | Gutter Cross Slope (%)                | N/A  |            |                               |      |
| Yes        | Overall Surface Condition: Acceptable |      | Yes        | Perp Joint Present            | Yes  |
|            | Cross Gutter Present?                 | Yes  |            | Spandrel Present?             | Yes  |
|            | Replace Cross Gutter?                 | No   |            | Replace Spandrel?             | No   |