



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: S_ESPLANADE_ST **Cross Street:** E_PEARL_ST **Location:** NE

ADA ID: RPAT210927133725 **Ramp Type:** Type 4 - Parallel **Initial Pass/Fail:** Fail **Overall Compliance:** No **Severity Score:** 34

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

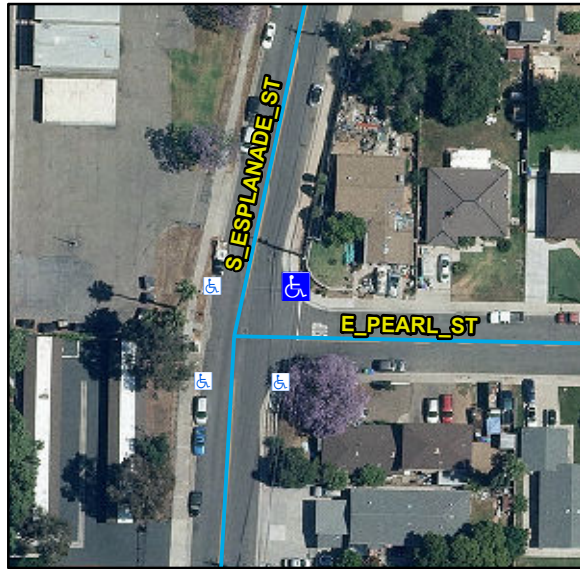

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
 N/A

OC Std/PROW:
 R304.5.1, R304.3.2, STD 1115

Total Cost: \$ 4000

Parcel ID Number: 093-111-32
Ramp Island Or Median: None
Ramp Orientation: Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78875319,-117.80948288

Street 1 Name: S_ESPLANADE_ST
Stop Condition-Street 1: NoControl
Street 2 Name: E_PEARL_ST
Stop Condition-Street 2: StopSign

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	72	N/A	Ramp Length RT (in)	115
No	Ramp Width LT (in)	47	Yes	Ramp Width RT (in)	48
Yes	Ramp Run Slope LT (%)	5	No	Ramp Run Slope RT (%)	12.9
Yes	Ramp Cross Slope LT (%)	0.6	Yes	Ramp Cross Slope RT (%)	0.8
N/A	Landing Present	N/A	N/A	DWS Provided	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Contrast	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Cross Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	N/A			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.3		Crossing 2 Slope (%)	2.7
	Crossing 1 Cross Slope (%)	0.6		Crossing 2 Cross Slope (%)	6.8
N/A	Gutter Ponding	N/A	N/A	Curb Slope	4.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4.2
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.8
N/A	Gutter Cross Slope (%)	N/A	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

