



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: HEWES_ST Cross Street: VINE_ST Location: SW

ADA ID: RPAT210929092610 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 6

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

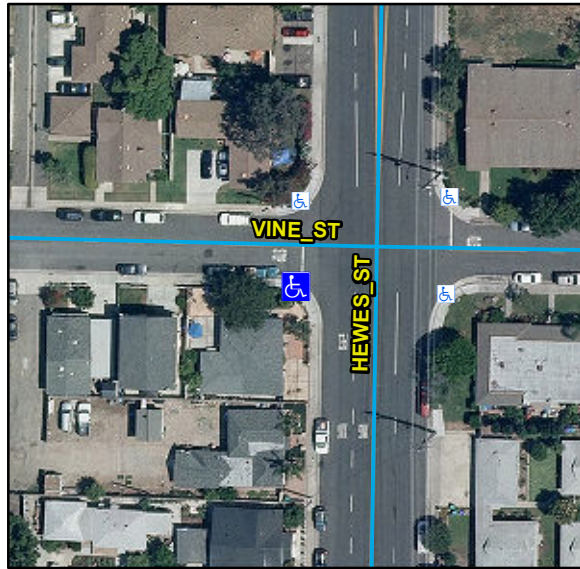

Possible Solutions:

Remove & Replace Landing. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.5.4, STD 1115

Total Cost: \$ 783

Parcel ID Number **093-103-27**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79041565,-117.80585392

Street 1 Name **HEWES_ST**
Stop Condition-Street 1 **NoControl**
Street 2 Name **VINE_ST**
Stop Condition-Street 2 **StopSign**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	106	N/A	Ramp Length RT (in)	72
Yes	Ramp Width LT (in)	48	Yes	Ramp Width RT (in)	48
Yes	Ramp Run Slope LT (%)	6.7	Yes	Ramp Run Slope RT (%)	1.2
Yes	Ramp Cross Slope LT (%)	0.5	Yes	Ramp Cross Slope RT (%)	0.9
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	48	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	0.9	Yes	DWS Full Width	Yes
No	Landing Cross Slope (%)	4.1		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	E		Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	6.7		Crossing 2 Slope (%)	3.3
	Crossing 1 Cross Slope (%)	0.7		Crossing 2 Cross Slope (%)	5.1
Yes	Gutter Ponding	No	Yes	Curb Slope	6.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.4
No	Gutter Run Slope (%)	5.9		Road Cross Slope (%)	5.7
No	Gutter Cross Slope (%)	4.9	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

