




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: CHAPMAN_AVE		Cross Street: RANCHO_SANTIAGO_BLVD		Location:	SW
ADA ID: RPAT210929124617	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	5
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

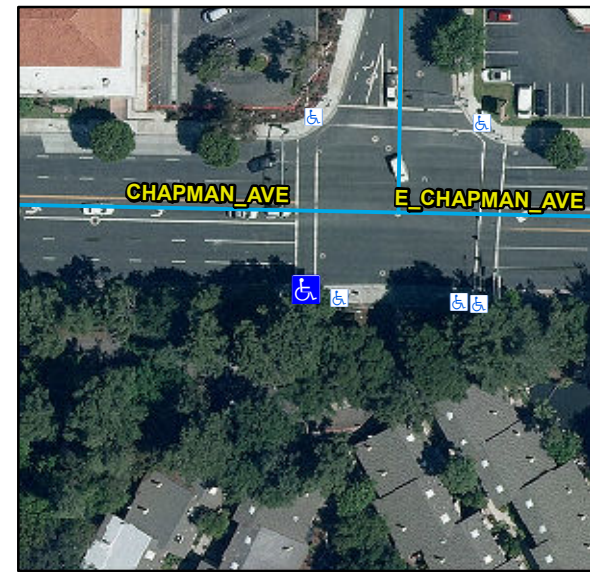

Possible Solutions:

Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.4, STD 1115

Total Cost: \$ 252

Parcel ID Number	393-151-57	Street 1 Name	CHAPMAN_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	Signal
Ramp Orientation	NonDiag	Street 2 Name	RANCHO_SANTIAGO_BLVD
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78760539,-117.80150076

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	120	N/A	Ramp Length RT (in)	110
Yes	Ramp Width LT (in)	78	Yes	Ramp Width RT (in)	79
Yes	Ramp Run Slope LT (%)	7.5	Yes	Ramp Run Slope RT (%)	6.6
Yes	Ramp Cross Slope LT (%)	0.7	Yes	Ramp Cross Slope RT (%)	0.2
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	79	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	0.2	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	1.6		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	N/A			
N/A	Clear Space To Crosswalk (in)	N/A			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	N		Crossing 2 Direction	N/A
Yes	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.8		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	1.1		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	Yes	Curb Slope	1.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	7.9		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	1.7	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A