



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: S_HEWES_ST Cross Street: CHAPMAN_AVE Location: SW

ADA ID: RPAT210929131945 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: Yes Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

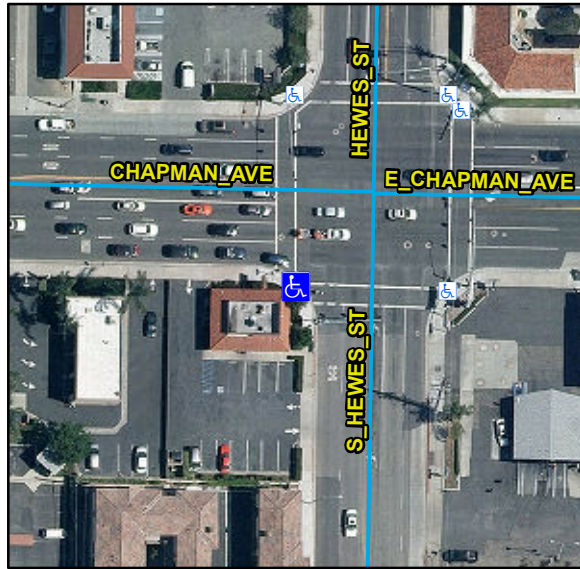

Possible Solutions:

N/A

Surveyor Notes:

N/A

OC Std/PROW:

N/A

Total Cost:

\$ 0

Parcel ID Number 392-181-01
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78760033,-117.80585223

Street 1 Name S_HEWES_ST
Stop Condition-Street 1 Signal
Street 2 Name CHAPMAN_AVE
Stop Condition-Street 2 Signal

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	113	N/A	Ramp Length RT (in)	114
Yes	Ramp Width LT (in)	77	Yes	Ramp Width RT (in)	78
Yes	Ramp Run Slope LT (%)	6	Yes	Ramp Run Slope RT (%)	6.6
Yes	Ramp Cross Slope LT (%)	1.2	Yes	Ramp Cross Slope RT (%)	0.4
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	77	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	49	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.1	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	1.7		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
Yes	Clear Space	Yes			
Yes	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	E		Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	120
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	3.5		Crossing 2 Slope (%)	5.3
	Crossing 1 Cross Slope (%)	1.5		Crossing 2 Cross Slope (%)	2.4
Yes	Gutter Ponding	No	Yes	Curb Slope	3.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.7
Yes	Gutter Run Slope (%)	2.8		Road Cross Slope (%)	4.8
Yes	Gutter Cross Slope (%)	0.7	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

