



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: E_CHAPMAN_AVE		Cross Street: EARLHAM_ST		Location:	NW
ADA ID: RPAT210929151105	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	10
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Detectable Warning System.
Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R305.1.4, R304.5.4, STD 1115


Total Cost: \$ 1052

Parcel ID Number	093-113-27	Street 1 Name	E_CHAPMAN_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	EARLHAM_ST
Google Street View Link:		Stop Condition-Street 2	StopSign

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.78790403,-117.80797847

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

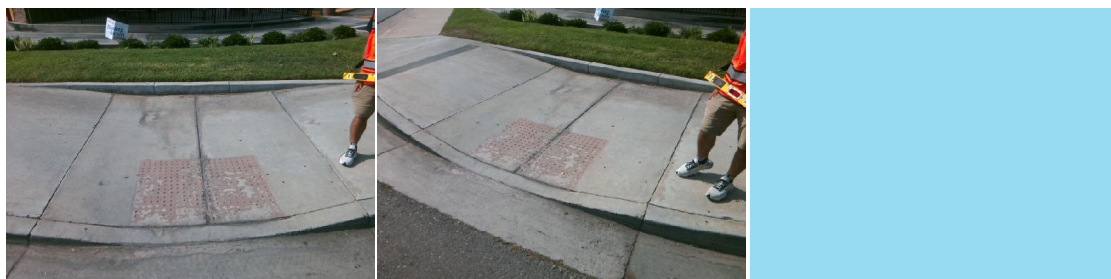

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	68	N/A	Ramp Length RT (in)	70
Yes	Ramp Width LT (in)	113	Yes	Ramp Width RT (in)	104
Yes	Ramp Run Slope LT (%)	8.2	Yes	Ramp Run Slope RT (%)	7.1
Yes	Ramp Cross Slope LT (%)	0.9	Yes	Ramp Cross Slope RT (%)	1.1
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	104	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	100	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.5	No	DWS Full Width	No
Yes	Landing Cross Slope (%)	1.1		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.1		Crossing 2 Slope (%)	4.6
	Crossing 1 Cross Slope (%)	1		Crossing 2 Cross Slope (%)	3.5
Yes	Gutter Ponding	No	Yes	Curb Slope	4.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.2
No	Gutter Run Slope (%)	5.6		Road Cross Slope (%)	4.5
Yes	Gutter Cross Slope (%)	0.1	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A