



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: AUBURN_AVE Cross Street: SANDHURST_ST Location: SE

ADA ID: RPAT211006133116 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 18

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

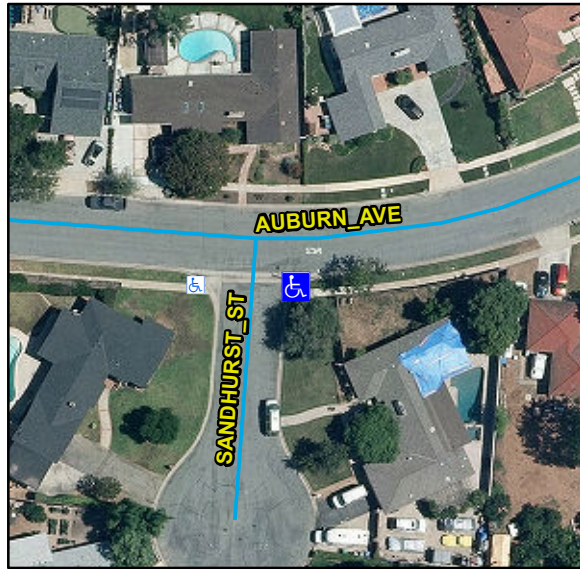

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, R304.5.3, R304.5.2, R305, STD 1115

Total Cost: \$ 3080

Parcel ID Number 395-481-27
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7602788,-117.80834994

Street 1 Name AUBURN_AVE
Stop Condition-Street 1 NoControl
Street 2 Name SANDHURST_ST
Stop Condition-Street 2 NoControl

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A		Street Light	

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	116	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	5	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.1	N/A	Flare Traversable LT	No
No	Grade Break	No	Yes	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			Curbed2
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	No	DWS Provided	No
N/A	Landing Present	Yes	N/A	DWS Contrast	N/A
No	Landing Length (in)	32	N/A	DWS Length (in)	N/A
No	Landing Width (in)	47	N/A	DWS Full Width	N/A
Yes	Landing Run Slope (%)	2		DWS Offset Type	N/A
No	Landing Cross Slope (%)	3.5	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	N	N/A	Clear Space To Crosswalk (in)	48
N/A	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	5			
	Crossing 1 Cross Slope (%)	0.2			
Yes	Gutter Ponding	No	Yes	Curb Slope	4.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.8
Yes	Gutter Run Slope (%)	4.5		Road Cross Slope (%)	2.9
Yes	Gutter Cross Slope (%)	0.6		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

