




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: WINTHROPE_ST		Cross Street: WINTHROPE_ST		Location:	SE
ADA ID: RPAT211006134332	Ramp Type: Type 6 - Directional 1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	15
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

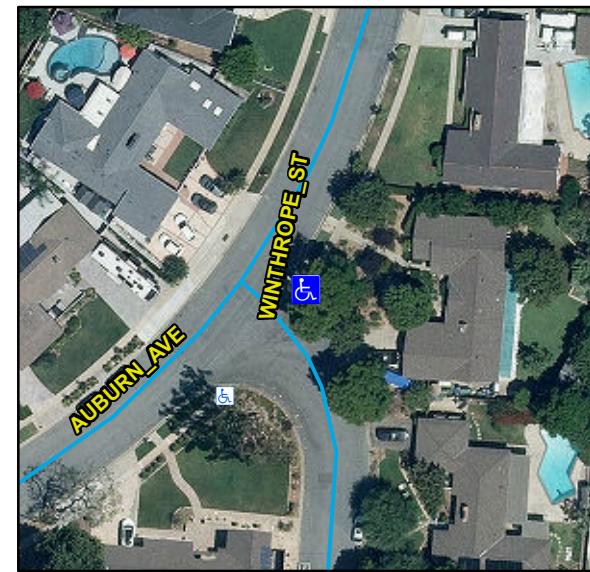

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Gutter Ponding Observed.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.5.2, R305, R302.7, STD 1115


Total Cost: \$ 3332

Parcel ID Number	395-481-18	Street 1 Name	WINTHROPE_ST
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	WINTHROPE_ST
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76079613,-117.80720929

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

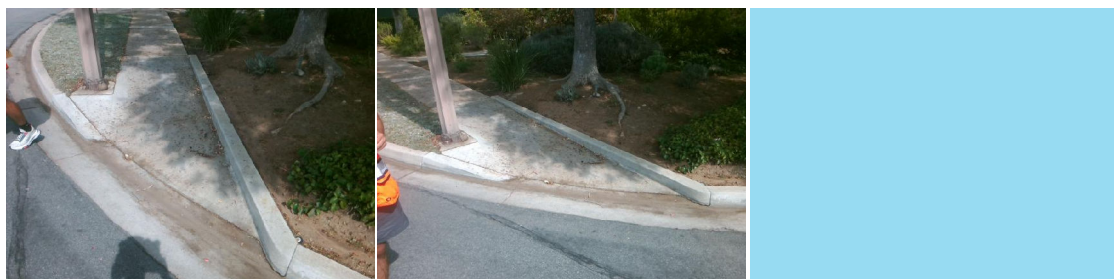

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	144	N/A	Flare Type LT	
Yes	Ramp Width (in)	49			Sloped
Yes	Ramp Run Slope (%)	8.2	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.7	N/A	Flare Traversable LT	No
No	Grade Break	No	Yes	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			Curbed2
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	No	DWS Provided	No
N/A	Landing Present	Yes	N/A	DWS Contrast	N/A
Yes	Landing Length (in)	48	N/A	DWS Length (in)	N/A
Yes	Landing Width (in)	48	N/A	DWS Full Width	N/A
No	Landing Run Slope (%)	5.3		DWS Offset Type	N/A
No	Landing Cross Slope (%)	5	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	N	N/A	Clear Space To Crosswalk (in)	48
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	4.9			
	Crossing 1 Cross Slope (%)	2.4			
No	Gutter Ponding	Yes	Yes	Curb Slope	4.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4.7
Yes	Gutter Run Slope (%)	3.1		Road Cross Slope (%)	2
Yes	Gutter Cross Slope (%)	2.1		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A