



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **BRENAN_WAY** Cross Street: **AUBURN_AVE** Location: **NE**

ADA ID: **RPAT211006135857** Ramp Type: **Type 4 - Parallel** Initial Pass/Fail: **Pass** Overall Compliance: **No** Severity Score: **2**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

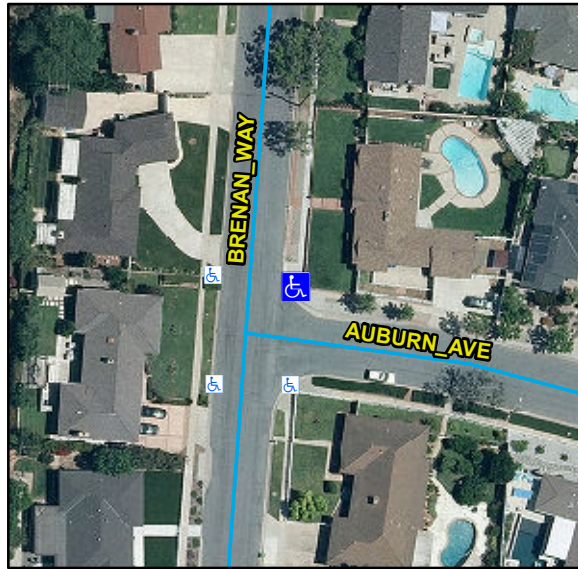

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Gutter Ponding Observed.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, R304.2.2-Perp, R304.3.2-Para, R302.7, STD 1115

Total Cost: \$ **4252**

Parcel ID Number **395-473-07**

Ramp Island Or Median **None**

Ramp Orientation **Diag**

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76069931,-117.81105374

Street 1 Name **BRENAN_WAY**

Stop Condition-Street 1 **NoControl**

Street 2 Name **AUBURN_AVE**

Stop Condition-Street 2 **NoControl**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	62	N/A	Ramp Length RT (in)	96
Yes	Ramp Width LT (in)	84	Yes	Ramp Width RT (in)	102
Yes	Ramp Run Slope LT (%)	5.7	Yes	Ramp Run Slope RT (%)	5.8
Yes	Ramp Cross Slope LT (%)	2	No	Ramp Cross Slope RT (%)	2.9
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	60	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
No	Landing Run Slope (%)	2.7	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	1.3		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.8		Crossing 2 Slope (%)	1.6
	Crossing 1 Cross Slope (%)	0.7		Crossing 2 Cross Slope (%)	3.5
No	Gutter Ponding	Yes	N/A	Curb Slope	7.6
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.2
Yes	Gutter Run Slope (%)	2.4		Road Cross Slope (%)	3.8
Yes	Gutter Cross Slope (%)	0.4	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

