



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **BRENAN_WAY** Cross Street: **MILFORD_RD** Location: **NW**

ADA ID: **RPAT211007135928** Ramp Type: **Type 6 - Directional 1** Initial Pass/Fail: **Fail** Overall Compliance: **No** Severity Score: **15**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

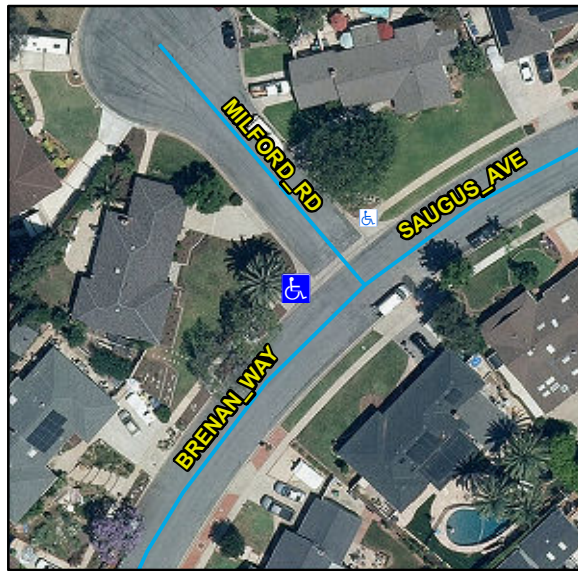

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.3, STD 1115

Total Cost: \$ **3080**

Parcel ID Number **395-461-10**

Ramp Island Or Median **None**

Ramp Orientation **Diag**

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76381219,-117.81054851

Street 1 Name **BRENAN_WAY**

Stop Condition-Street 1 **NoControl**

Street 2 Name **MILFORD_RD**

Stop Condition-Street 2 **NoControl**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	112	N/A	Flare Type LT	
Yes	Ramp Width (in)	60			N/A
Yes	Ramp Run Slope (%)	5.1	N/A	Flare Slope LT (%)	N/A
No	Ramp Cross Slope (%)	6	N/A	Flare Traversable LT	N/A
N/A	Grade Break	N/A	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			N/A
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	N/A	DWS Provided	N/A
N/A	Landing Present	N/A	N/A	DWS Contrast	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Run Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	S	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	3.1			
	Crossing 1 Cross Slope (%)	0.1			
N/A	Gutter Ponding	N/A	N/A	Curb Slope	2.8
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	2.6
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.7
N/A	Gutter Cross Slope (%)	N/A		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

