



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: ROLLINGSTONE_LN		Cross Street: CHIRPING_SPARROW_WAY		Location:	SW
ADA ID: RPAT211008124608	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	2
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		



Possible Solutions:

Remove & Replace Curb Slope.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, STD 1115


Total Cost: \$ 252

Parcel ID Number	103-374-12	Street 1 Name	ROLLINGSTONE_LN
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	CHIRPING_SPARROW_WAY
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.73956646,-117.80018402

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

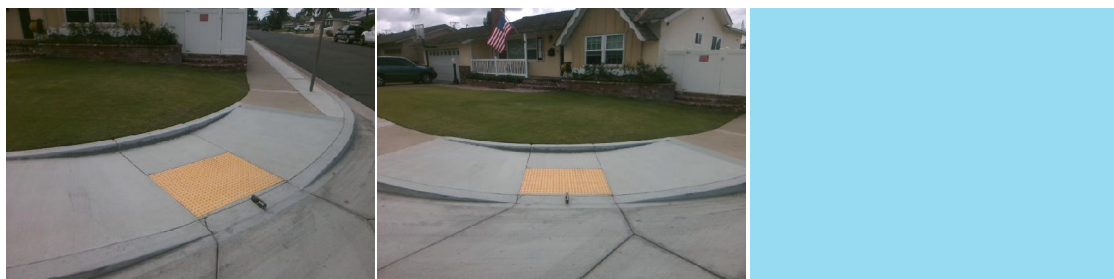

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	88	N/A	Ramp Length RT (in)	95
Yes	Ramp Width LT (in)	70	Yes	Ramp Width RT (in)	72
Yes	Ramp Run Slope LT (%)	6.6	Yes	Ramp Run Slope RT (%)	4.8
Yes	Ramp Cross Slope LT (%)	1.1	Yes	Ramp Cross Slope RT (%)	2
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	69	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	2	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	2.3		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	E		Crossing 2 Direction	N
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.7		Crossing 2 Slope (%)	4.9
	Crossing 1 Cross Slope (%)	4.4		Crossing 2 Cross Slope (%)	1.7
Yes	Gutter Ponding	No	No	Curb Slope	14.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.2
Yes	Gutter Run Slope (%)	2.3		Road Cross Slope (%)	2.7
Yes	Gutter Cross Slope (%)	2.4	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No