

Access Compliance Report Public Rights-of-Way (Curb Ramps)




26

Main Street: CHARLOMA DR **Cross Street: LURLINE LN** NW Location:

Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass ADA ID: RPAT211011100455

Overall Compliance: No Severity Score:

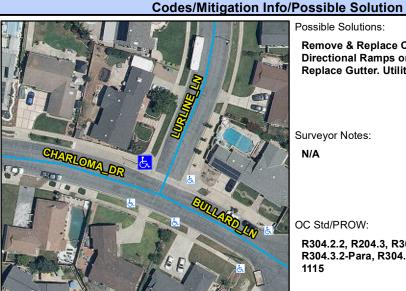

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter. Utility Present.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4, STD 1115

Total Cost: 6412

Parcel ID Number	103-141-08	Street 1 Name	CHARLOMA_DR
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	LURLINE_LN
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74917482,-117.80327239

Obstruction and Utility Measurement/Component Compliance

Com	pliance Description	Data	Com	pliance Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	Yes
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A	J		Power Pole



Field Measurements/Component Compliance								
-	Com	pliance Description	Data	Com	pliance Description	Data		
	N/A	Ramp Length (in)	132	N/A	Flare Type LT			
	Yes	Ramp Width (in)	52			Sloped		
	Yes	Ramp Run Slope (%)	6.3	N/A	Flare Slope LT (%)	8.1		
	Yes	Ramp Cross Slope (%)	1.8	N/A	Flare Traversable LT	No		
	N/A	Landing Present	No	N/A	Flare Type RT			
	N/A	Landing Length (in)	N/A			Sloped		
	No	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	6.9		
	No	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	No		
	No	Landing Cross Slope (%)	N/A	No	DWS Provided	No		
	N/A	Landing Movement Obstructed?	Yes	N/A	DWS Contrast	N/A		
		Landing Movement Type	Wall	N/A	DWS Length (in)	N/A		
	N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A		
	N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A		
	N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A		
2	N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No		
		Crossing 1 Direction	E		Crossing 2 Direction	S		
١ ا		Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A		
ı	N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A		
ı		Crossing 1 Slope (%)	6		Crossing 2 Slope (%)	2.7		
ı		Crossing 1 Cross Slope (%)	2.9		Crossing 2 Cross Slope (%)	4.1		
	Yes	Gutter Ponding	No	No	Curb Slope	8.2		
	Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.4		
	No	Gutter Run Slope (%)	6.1		Road Cross Slope (%)	4.7		
-	Yes	Gutter Cross Slope (%)	0.7					
•	Yes Overall Surface Condition: Acceptable		No	Perp Joint Present	No			
		Cross Gutter Present?	Yes		Spandrel Present?	Yes		
'		Replace Cross Gutter?	No		Replace Spandrel?	No		