



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: WINDSOR_LN Cross Street: ENRAMADA_DR Location: SW

ADA ID: RPAT21101111117 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 4

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

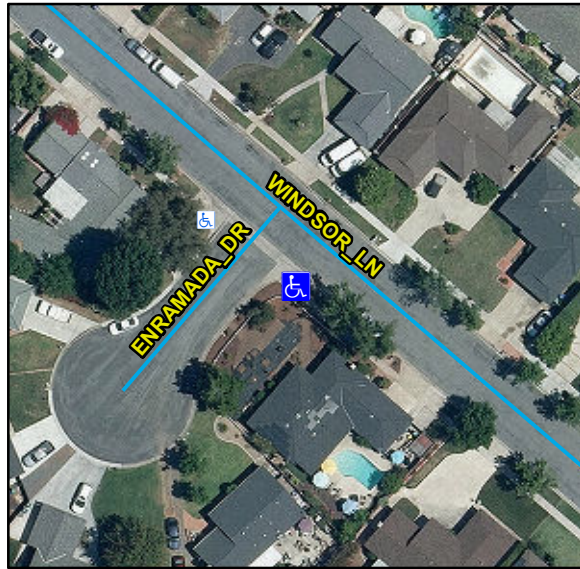

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.1, STD 1115

Total Cost: \$ 3080

Parcel ID Number 501-012-12
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

Street 1 Name WINDSOR_LN
Stop Condition-Street 1 NoControl
Street 2 Name ENRAMADA_DR
Stop Condition-Street 2 NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.75293998,-117.80506233

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	112	N/A	Flare Type LT	
No	Ramp Width (in)	47			N/A
Yes	Ramp Run Slope (%)	6.8	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	0.2	N/A	Flare Traversable LT	N/A
N/A	Grade Break	N/A	N/A	Flare Type RT	
N/A	Grade Break Slope (%)	N/A			N/A
N/A	Grade Break Cross Slope (%)	N/A	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	N/A	DWS Provided	N/A
N/A	Landing Present	N/A	N/A	DWS Contrast	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Full Width	N/A
N/A	Landing Run Slope (%)	N/A		DWS Offset Type	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Left Offset (in)	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Right Offset (in)	N/A
	Landing Movement Type	N/A			
N/A	Landing Shared	N/A			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	E	N/A	Clear Space To Crosswalk (in)	N/A
N/A	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	1.2			
	Crossing 1 Cross Slope (%)	0.1			
N/A	Gutter Ponding	N/A	N/A	Curb Slope	1.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.8
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	0.6
N/A	Gutter Cross Slope (%)	N/A		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

