



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **BROWNING_AVE** Cross Street: **BURNT_MILL_RD** Location: **SE**

ADA ID: **RPAT211012110443** Ramp Type: **Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass** Overall Compliance: **No** Severity Score: **10**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

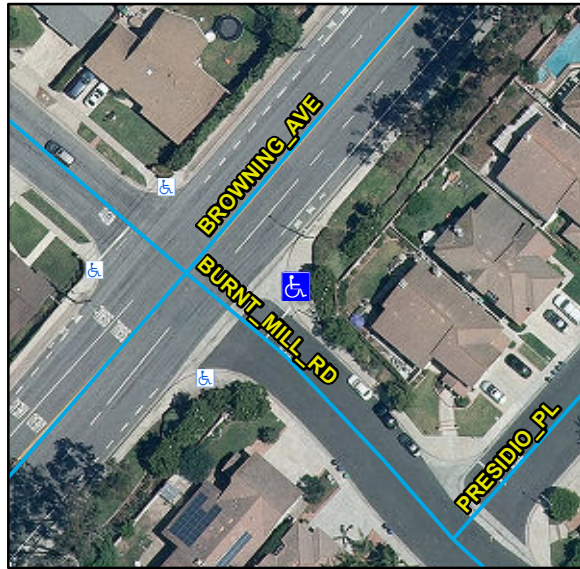

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R305, STD 1115

Total Cost: \$ **6160**

Parcel ID Number **500-281-30**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.73553531,-117.80190491

Street 1 Name **BROWNING_AVE**
Stop Condition-Street 1 **NoControl**
Street 2 Name **BURNT_MILL_RD**
Stop Condition-Street 2 **StopSign**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	105	N/A	Flare Type LT	
Yes	Ramp Width (in)	50			Sloped
Yes	Ramp Run Slope (%)	4.9	Yes	Flare Slope LT (%)	9
Yes	Ramp Cross Slope (%)	1.2	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	65			Sloped
Yes	Landing Width (in)	124	Yes	Flare Slope RT (%)	7.3
Yes	Landing Run Slope (%)	0.3	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	1.8	No	DWS Provided	No
N/A	Landing Movement Obstructed?	No	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	N		Crossing 2 Direction	W
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.1		Crossing 2 Slope (%)	0.2
	Crossing 1 Cross Slope (%)	0.1		Crossing 2 Cross Slope (%)	1.2
Yes	Gutter Ponding	No	Yes	Curb Slope	0.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.6
Yes	Gutter Run Slope (%)	4		Road Cross Slope (%)	1.1
Yes	Gutter Cross Slope (%)	0.8			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

