




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: SIERRA_ALTA_DR		Cross Street: KENWOOD_LN		Location:	NE
ADA ID: RPAT211013084449	Ramp Type: Type 6 - Directional 1	Initial Pass/Fail: Pass	Overall Compliance: Yes	Severity Score:	0
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

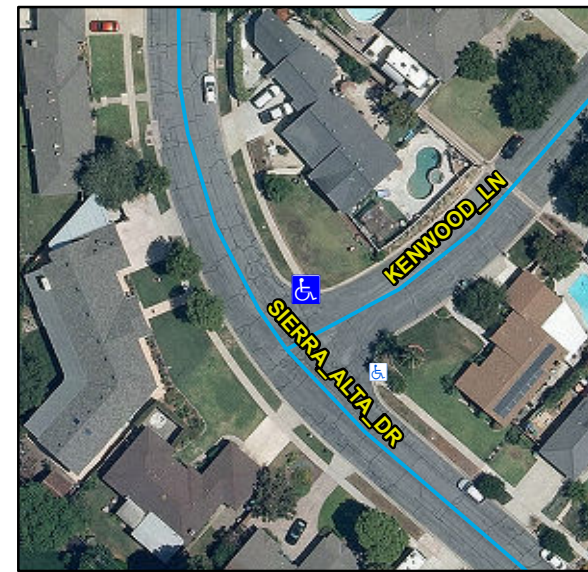

Possible Solutions:

N/A

Surveyor Notes:

N/A

OC Std/PROW:

N/A

Total Cost:

\$ 0

Parcel ID Number 103-722-01
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

Street 1 Name SIERRA_ALTA_DR
Stop Condition-Street 1 NoControl
Street 2 Name KENWOOD_LN
Stop Condition-Street 2 NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.74941526,-117.80191457

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	76	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	6.4	N/A	Flare Slope LT (%)	7.1
Yes	Ramp Cross Slope (%)	0.4	N/A	Flare Traversable LT	No
Yes	Grade Break	Yes	Yes	Flare Type RT	
Yes	Grade Break Slope (%)	0.5			Curbed2
Yes	Grade Break Cross Slope (%)	1.7	N/A	Flare Slope RT (%)	N/A
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	N/A
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
Yes	Landing Length (in)	56	Yes	DWS Length (in)	75
Yes	Landing Width (in)	48	Yes	DWS Full Width	Yes
Yes	Landing Run Slope (%)	1.1		DWS Offset Type	Single
Yes	Landing Cross Slope (%)	0.4	Yes	DWS Left Offset (in)	0
N/A	Landing Movement Obstructed?	No	N/A	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	Yes
	Crossing 1 Direction	W	N/A	Clear Space To Crosswalk (in)	48
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	3			
	Crossing 1 Cross Slope (%)	5.1			
Yes	Gutter Ponding	No	Yes	Curb Slope	1.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.8
Yes	Gutter Run Slope (%)	3.9		Road Cross Slope (%)	4.9
Yes	Gutter Cross Slope (%)	1.8		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A