



Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: GIGI_DR		Cross Street: SMOKE_TREE_LN		Location:	W
ADA ID: RPAT211014100940	Ramp Type: Type 3 - Combination 1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score:	19

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
---	--	--	---	--	--



Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.5.1, R304.2.2, R304.5.3, STD 1115


Total Cost: \$ 6160

Parcel ID Number	502-252-09	Street 1 Name	GIGI_DR
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	SMOKE_TREE_LN
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76562684,-117.79231576

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

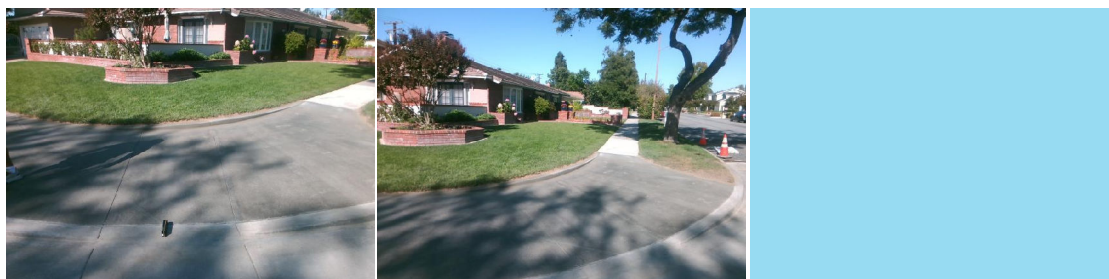

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	141	N/A	Ramp Length RT (in)	125
No	Ramp Width LT (in)	46	Yes	Ramp Width RT (in)	56
Yes	Ramp Run Slope LT (%)	2.5	Yes	Ramp Run Slope RT (%)	7.6
Yes	Ramp Cross Slope LT (%)	0.2	No	Ramp Cross Slope RT (%)	2.2
N/A	Ramp Length (in)	60	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			N/A
No	Ramp Run Slope (%)	8.8	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.8	N/A	Flare Traversable LT	N/A
N/A	Landing Present	N/A	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			N/A
N/A	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	N/A
N/A	Landing Cross Slope (%)	N/A	N/A	DWS Provided	N/A
N/A	Landing Movement Obstructed?	N/A	N/A	DWS Contrast	N/A
	Landing Movement Type	N/A	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes		DWS Offset Type	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Left (in)	N/A
			N/A	DWS Offset Right (in)	N/A
Yes	Perp Joint Present	Yes			
	Parallel Ramp Side	N/A			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SE		Crossing 2 Direction	NE
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.3		Crossing 2 Slope (%)	2.8
	Crossing 1 Cross Slope (%)	2.3		Crossing 2 Cross Slope (%)	4.1
N/A	Gutter Ponding	N/A	N/A	Curb Slope	3.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	4
N/A	Gutter Run Slope (%)	N/A		Road Cross Slope (%)	4.6
N/A	Gutter Cross Slope (%)	N/A			
Yes	Overall Surface Condition: Acceptable				
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No