


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Main Street: HEWES AVE **Cross Street: DODGE AVE** Location: SW

ADA ID: RPAT211015090636 Ramp Type: Type 4 - Parallel **Initial Pass/Fail: Pass Overall Compliance: No Severity Score:** 

## **Codes/Mitigation Info/Possible Solution**

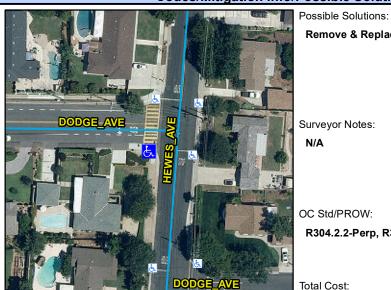

Remove & Replace Landing.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2-Perp, R304.3.2-Para, STD 1115

Total Cost:

531

Parcel ID Number		Street 1 Name
Ramp Island Or Median	None	Stop Condition-Street 1
Ramp Orientation	Diag	Street 2 Name
Google Street View Link:		Stop Condition-Street 2

http://www.google.com/maps/@?api=1&map\_action=pano&viewpoint=33.76636621,-117.80596343

## **Obstruction and Utility Measurement/Component Compliance**

Com	pliance Description	Data	Com	pliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities	Present?	No
	Obstruction Types	N/A		Utility T	ypes	
	Obstruction Dimensions	N/A				N/A



Field Measurements/Component Compliance									
	Compliance Description		Data	Com	pliance Description	Data			
	N/A	Ramp Length LT (in)	38	N/A	Ramp Length RT (in)	45			
	Yes	Ramp Width LT (in)	61	Yes	Ramp Width RT (in)	59			
	Yes	Ramp Run Slope LT (%)	2.5	Yes	Ramp Run Slope RT (%)	4.3			
	Yes	Ramp Cross Slope LT (%)	8.0	Yes	Ramp Cross Slope RT (%)	0.3			
	N/A	Landing Present	Yes	Yes	DWS Provided	Yes			
	N/A	Landing Length (in)	60	Yes	DWS Contrast	Yes			
	Yes	Landing Width (in)	48	Yes	DWS Length (in)	36			
	No	Landing Run Slope (%)	3.9	Yes	DWS Full Width	Yes			
	Yes	Landing Cross Slope (%)	0.4		DWS Offset Type	Single			
	N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0			
		Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A			
115	N/A	Landing Shared	No						
	N/A	Clear Space	Yes						
	N/A	Clear Space To Crosswalk (in)	48						
\$ 531	N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	Yes			
		Crossing 1 Direction	Е		Crossing 2 Direction	N			
HEWES_AVE		Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	120			
StopSign	N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	Yes			
DODGE_AVE		Crossing 1 Slope (%)	3.8		Crossing 2 Slope (%)	0.6			
StopSign		Crossing 1 Cross Slope (%)	8.0		Crossing 2 Cross Slope (%)	1.5			
	Yes	Gutter Ponding	No	Yes	Curb Slope	3.9			
	Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.3			
_ ,	Yes	Gutter Run Slope (%)	1.6		Road Cross Slope (%)	2.2			
Data	Yes	Gutter Cross Slope (%)	0.3	Yes	Perpendicular Joint Present	Yes			
No Yes Overall Surface Condition Acceptal		eptable							
		Cross Gutter Present?	No		Spandrel Present?	No			
N/A		Replace Cross Gutter?	N/A		Replace Spandrel?	N/A			
	1								