




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: FLINT_DR		Cross Street: SANTA_CLARA_AVE		Location:	NE
ADA ID: RPAT211019091612	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	0
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

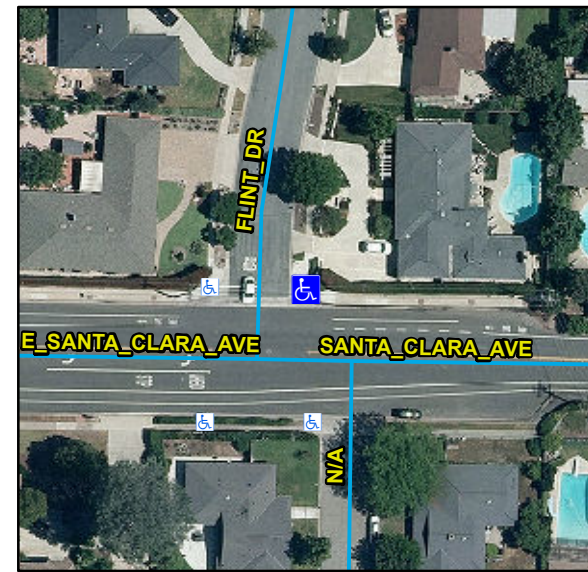

Possible Solutions:

Remove & Replace Curb Slope.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R302.7, STD 1115

Total Cost: \$ 252

Parcel ID Number **395-222-22**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

Street 1 Name **FLINT_DR**
Stop Condition-Street 1 **StopSign**
Street 2 Name **SANTA_CLARA_AVE**
Stop Condition-Street 2 **NoControl**

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76723201,-117.82110789

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	128	N/A	Ramp Length RT (in)	88
Yes	Ramp Width LT (in)	80	Yes	Ramp Width RT (in)	57
Yes	Ramp Run Slope LT (%)	7.9	Yes	Ramp Run Slope RT (%)	7
Yes	Ramp Cross Slope LT (%)	1.2	Yes	Ramp Cross Slope RT (%)	0.9
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	77	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	0.4	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.4		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	1
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.9		Crossing 2 Slope (%)	8.9
	Crossing 1 Cross Slope (%)	3.9		Crossing 2 Cross Slope (%)	0.7
No	Gutter Ponding	Yes	No	Curb Slope	9.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.5
Yes	Gutter Run Slope (%)	3.7		Road Cross Slope (%)	2.3
Yes	Gutter Cross Slope (%)	1.4	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No