




# Access Compliance Report Public Rights-of-Way (Curb Ramps)



|                                         |                              |                            |                                         |                 |    |
|-----------------------------------------|------------------------------|----------------------------|-----------------------------------------|-----------------|----|
| Main Street: SAUGUS_AVE                 |                              | Cross Street: WINTHROPE_ST |                                         | Location:       | NW |
| ADA ID: RPAT211026124350                | Ramp Type: Type 4 - Parallel | Initial Pass/Fail: Pass    | Overall Compliance: No                  | Severity Score: | 12 |
| Codes/Mitigation Info/Possible Solution |                              |                            | Field Measurements/Component Compliance |                 |    |

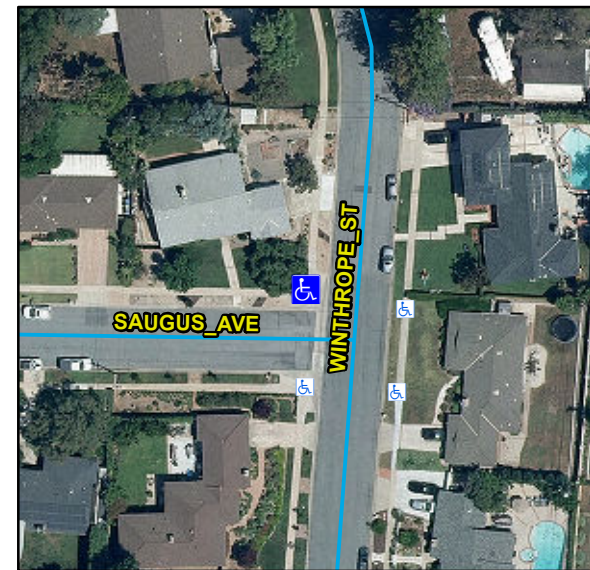

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

N/A

OC Std/PROW:

**R204.3, R304.5.3, R304.2.2-Perp, R304.3.2-Para, R305, STD 1115**

Total Cost: \$ 4000

|                          |            |                         |              |
|--------------------------|------------|-------------------------|--------------|
| Parcel ID Number         | 395-451-28 | Street 1 Name           | SAUGUS_AVE   |
| Ramp Island Or Median    | None       | Stop Condition-Street 1 | NoControl    |
| Ramp Orientation         | Diag       | Street 2 Name           | WINTHROPE_ST |
| Google Street View Link: |            | Stop Condition-Street 2 | NoControl    |

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.76423395,-117.80696829](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76423395,-117.80696829)

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |



| Compliance | Description                   | Data       | Compliance | Description                   | Data |
|------------|-------------------------------|------------|------------|-------------------------------|------|
| N/A        | Ramp Length LT (in)           | 127        | N/A        | Ramp Length RT (in)           | 140  |
| Yes        | Ramp Width LT (in)            | 85         | Yes        | Ramp Width RT (in)            | 94   |
| Yes        | Ramp Run Slope LT (%)         | 6.7        | Yes        | Ramp Run Slope RT (%)         | 5.4  |
| Yes        | Ramp Cross Slope LT (%)       | 1.9        | No         | Ramp Cross Slope RT (%)       | 2.6  |
| N/A        | Landing Present               | Yes        | No         | DWS Provided                  | No   |
| N/A        | Landing Length (in)           | 54         | N/A        | DWS Contrast                  | N/A  |
| Yes        | Landing Width (in)            | 140        | N/A        | DWS Length (in)               | N/A  |
| No         | Landing Run Slope (%)         | 2.5        | N/A        | DWS Full Width                | N/A  |
| Yes        | Landing Cross Slope (%)       | 0.5        |            | DWS Offset Type               | N/A  |
| N/A        | Landing Movement Obstructed?  | No         | N/A        | DWS Offset Left (in)          | N/A  |
|            | Landing Movement Type         | Curb       | N/A        | DWS Offset Right (in)         | N/A  |
| N/A        | Landing Shared                | No         |            |                               |      |
| N/A        | Clear Space                   | Yes        |            |                               |      |
| N/A        | Clear Space To Crosswalk (in) | 48         |            |                               |      |
| N/A        | Marked Crosswalk 1            | No         | N/A        | Marked Crosswalk 2            | No   |
|            | Crossing 1 Direction          | E          |            | Crossing 2 Direction          | S    |
|            | Marked Crosswalk 1 Width (in) | N/A        |            | Marked Crosswalk 2 Width (in) | N/A  |
| N/A        | Ramp Inside Crosswalk 1       | N/A        | N/A        | Ramp Inside Crosswalk 2       | N/A  |
|            | Crossing 1 Slope (%)          | 0.6        |            | Crossing 2 Slope (%)          | 3.2  |
|            | Crossing 1 Cross Slope (%)    | 0.7        |            | Crossing 2 Cross Slope (%)    | 0.5  |
| Yes        | Gutter Ponding                | No         | N/A        | Curb Slope                    | 0.8  |
| Yes        | Gutter Lip Height (in)        | 0          |            | Road Run Slope (%)            | 1.1  |
| Yes        | Gutter Run Slope (%)          | 1.7        |            | Road Cross Slope (%)          | 0.6  |
| Yes        | Gutter Cross Slope (%)        | 0.9        | No         | Perpendicular Joint Present   | No   |
| Yes        | Overall Surface Condition     | Acceptable |            |                               |      |
|            | Cross Gutter Present?         | Yes        |            | Spandrel Present?             | Yes  |
|            | Replace Cross Gutter?         | No         |            | Replace Spandrel?             | No   |