




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: WINTHROPE_ST		Cross Street: SAUGUS_AVE		Location:	SW
ADA ID: RPAT211026125132	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	0
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

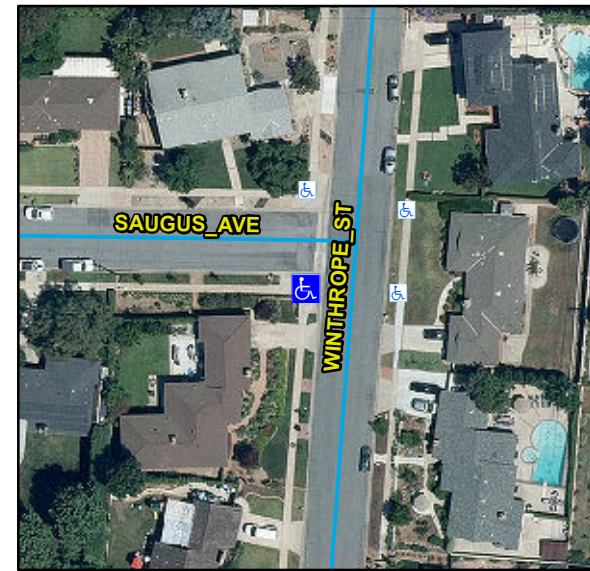

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, STD 1115


Total Cost: \$ 4000

Parcel ID Number	395-454-01	Street 1 Name	WINTHROPE_ST
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	SAUGUS_AVE
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.76408482,-117.80696845

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

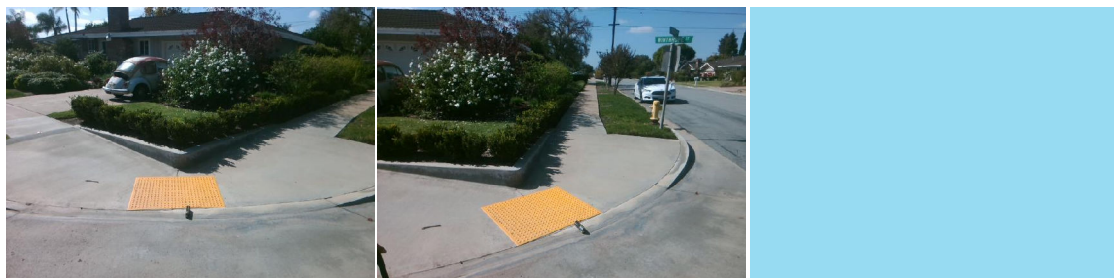

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	124	N/A	Ramp Length RT (in)	133
Yes	Ramp Width LT (in)	82	Yes	Ramp Width RT (in)	100
Yes	Ramp Run Slope LT (%)	4.5	Yes	Ramp Run Slope RT (%)	6.2
Yes	Ramp Cross Slope LT (%)	1.8	Yes	Ramp Cross Slope RT (%)	1.1
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	52	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	140	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.7	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	1.2		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SE		Crossing 2 Direction	NE
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.4		Crossing 2 Slope (%)	1.4
	Crossing 1 Cross Slope (%)	1.3		Crossing 2 Cross Slope (%)	3.1
Yes	Gutter Ponding	No	Yes	Curb Slope	7.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.9
Yes	Gutter Run Slope (%)	1.9		Road Cross Slope (%)	0.1
Yes	Gutter Cross Slope (%)	0.9	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No