



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: LASSEN_DR Cross Street: ESPLANADE_AVE Location: SW

ADA ID: RPAT211026135644 Ramp Type: Type 6 - Directional 1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 6

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

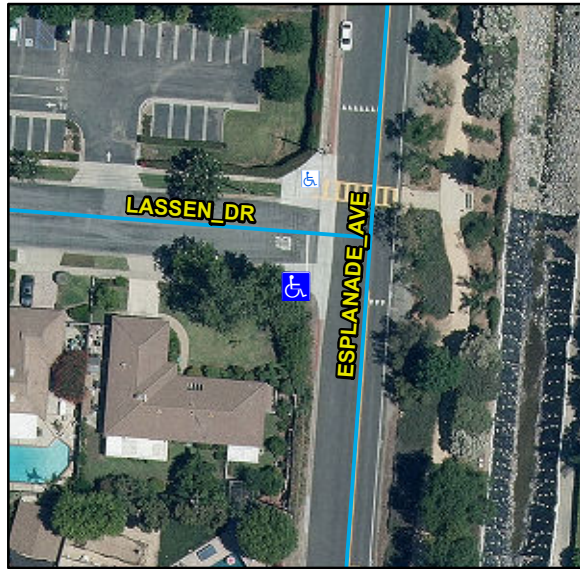

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, STD 1115

Total Cost: \$ 3332

Parcel ID Number 395-423-04
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.77186611,-117.81114848

Street 1 Name LASSEN_DR
Stop Condition-Street 1 StopSign
Street 2 Name ESPLANADE_AVE
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	122	Yes	Flare Type LT	Curbed2
Yes	Ramp Width (in)	49			
Yes	Ramp Run Slope (%)	8.1	N/A	Flare Slope LT (%)	N/A
Yes	Ramp Cross Slope (%)	1.2	N/A	Flare Traversable LT	N/A
Yes	Grade Break	Yes	N/A	Flare Type RT	
Yes	Grade Break Slope (%)	3.6			Sloped
Yes	Grade Break Cross Slope (%)	0.3	N/A	Flare Slope RT (%)	13
	Addl Para Ramp Left?	No	N/A	Flare Traversable RT	No
	Addl Para Ramp Right?	No	Yes	DWS Provided	Yes
N/A	Landing Present	Yes	Yes	DWS Contrast	Yes
No	Landing Length (in)	25	Yes	DWS Length (in)	36
Yes	Landing Width (in)	48	Yes	DWS Full Width	Yes
No	Landing Run Slope (%)	3.5		DWS Offset Type	Multiple
No	Landing Cross Slope (%)	2.5	Yes	DWS Left Offset (in)	24
N/A	Landing Movement Obstructed?	No	Yes	DWS Right Offset (in)	0
	Landing Movement Type	N/A			
N/A	Landing Shared	No			
N/A	Marked Crosswalk 1	No	N/A	Clear Space	N/A
	Crossing 1 Direction	N	N/A	Clear Space To Crosswalk (in)	N/A
	Marked Crosswalk 1 Width (in)	N/A			
N/A	Ramp Inside Crosswalk 1	N/A			
	Crossing 1 Slope (%)	0.6			
	Crossing 1 Cross Slope (%)	3.1			
Yes	Gutter Ponding	No	No	Curb Slope	12.9
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
Yes	Gutter Run Slope (%)	2.4		Road Cross Slope (%)	N/A
No	Gutter Cross Slope (%)	2.5		Parallel Ramp Side	N/A
Yes	Overall Surface Condition	Acceptable	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

