




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: E_BOND_AVE Cross Street: N_SWAN_ST Location: NW

ADA ID: RPAT211027135322 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 0

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

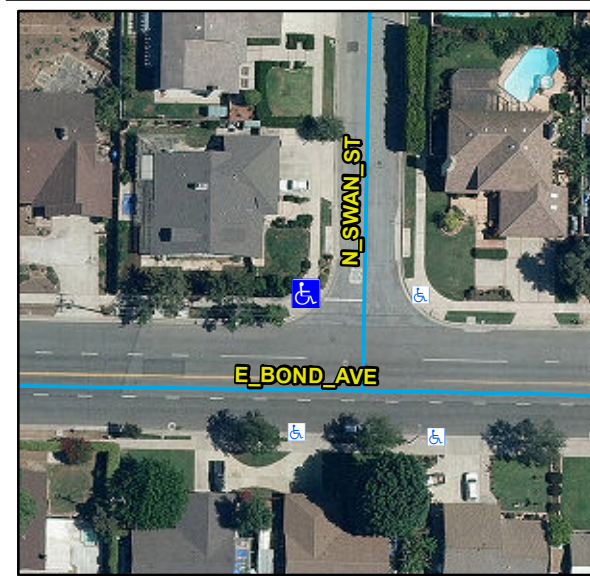

Possible Solutions:
Remove & Replace Landing. Remove & Replace Gutter.

Surveyor Notes:
N/A

OC Std/PROW:
R304.2.1, R304.5.3, STD 1115

Total Cost: \$ 783

Parcel ID Number **383-255-03**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79883297,-117.80318235

Street 1 Name **E_BOND_AVE**
Stop Condition-Street 1 **NoControl**
Street 2 Name **N_SWAN_ST**
Stop Condition-Street 2 **StopSign**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	88	N/A	Flare Type LT	
Yes	Ramp Width (in)	49			Sloped
Yes	Ramp Run Slope (%)	5.7	N/A	Flare Slope LT (%)	4.2
Yes	Ramp Cross Slope (%)	0.1	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	52			Sloped
Yes	Landing Width (in)	49	N/A	Flare Slope RT (%)	4.7
Yes	Landing Run Slope (%)	1.2	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	1.1	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Wall	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	Yes	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SW		Crossing 2 Direction	SE
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	1.4		Crossing 2 Slope (%)	2.6
	Crossing 1 Cross Slope (%)	2.6		Crossing 2 Cross Slope (%)	0.3
Yes	Gutter Ponding	No	Yes	Curb Slope	2.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.4
Yes	Gutter Run Slope (%)	2.5		Road Cross Slope (%)	0.9
No	Gutter Cross Slope (%)	2.3			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A