



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: CANDLEWIND_CT Cross Street: CELESTINE_CIR Location: NE

ADA ID: RPAT211029120554 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

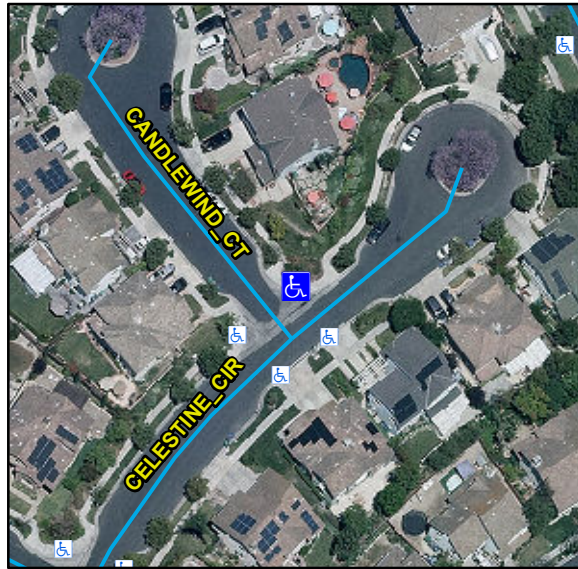

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R305, R304.5.4, STD 1115

Total Cost: \$ 4252

Parcel ID Number **741-011-19**
Ramp Island Or Median **None**
Ramp Orientation **Diag**
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54657282,-117.63634655

Street 1 Name **CANDLEWIND_CT**
Stop Condition-Street 1 **NoControl**
Street 2 Name **CELESTINE_CIR**
Stop Condition-Street 2 **NoControl**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	105	N/A	Ramp Length RT (in)	95
Yes	Ramp Width LT (in)	55	Yes	Ramp Width RT (in)	53
Yes	Ramp Run Slope LT (%)	6.7	Yes	Ramp Run Slope RT (%)	3.8
Yes	Ramp Cross Slope LT (%)	1.3	Yes	Ramp Cross Slope RT (%)	0.4
N/A	Landing Present	Yes	No	DWS Provided	No
N/A	Landing Length (in)	53	N/A	DWS Contrast	N/A
Yes	Landing Width (in)	58	N/A	DWS Length (in)	N/A
Yes	Landing Run Slope (%)	1.7	N/A	DWS Full Width	N/A
Yes	Landing Cross Slope (%)	2.6		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	W
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.4		Crossing 2 Slope (%)	1.9
	Crossing 1 Cross Slope (%)	2.3		Crossing 2 Cross Slope (%)	0.8
Yes	Gutter Ponding	No	No	Curb Slope	10
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.2
No	Gutter Run Slope (%)	7.4		Road Cross Slope (%)	3.3
Yes	Gutter Cross Slope (%)	1.3	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

