



# Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: PLUM\_ST Cross Street: CELESTINE\_CIR Location: NW

ADA ID: RPAT211029122828 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 16

## Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

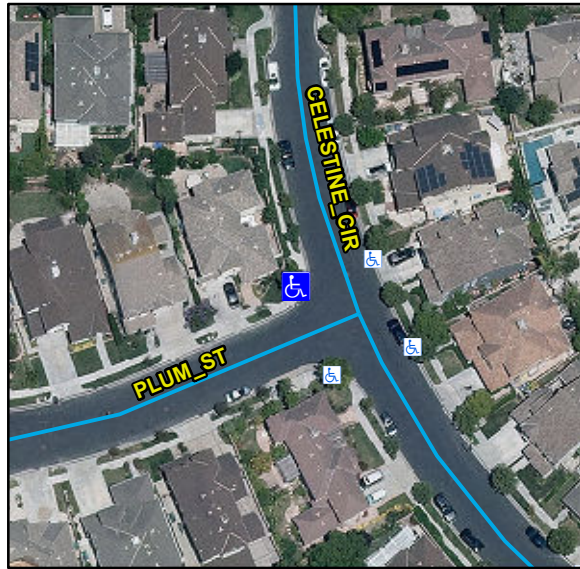

### Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

### Surveyor Notes:

N/A

### OC Std/PROW:

**R204.3, R304.2.2-Perp, R304.3.2-Para, R305, R302.7, R304.5.4, STD 1115**

Total Cost: \$ 4252

Parcel ID Number **741-101-09**  
Ramp Island Or Median **None**  
Ramp Orientation **Diag**  
Google Street View Link:

[http://www.google.com/maps/@?api=1&map\\_action=pano&viewpoint=33.54507749,-117.63686618](http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54507749,-117.63686618)

Street 1 Name **PLUM\_ST**  
Stop Condition-Street 1 **NoControl**  
Street 2 Name **CELESTINE\_CIR**  
Stop Condition-Street 2 **NoControl**

## Obstruction and Utility Measurement/Component Compliance

| Compliance | Description            | Data | Compliance | Description        | Data |
|------------|------------------------|------|------------|--------------------|------|
| Yes        | Obstructions Present?  | No   | N/A        | Utilities Present? | No   |
|            | Obstruction Types      | N/A  |            | Utility Types      |      |
|            | Obstruction Dimensions | N/A  |            |                    | N/A  |

| Compliance | Description                   | Data       | Compliance | Description                   | Data |
|------------|-------------------------------|------------|------------|-------------------------------|------|
| N/A        | Ramp Length LT (in)           | 88         | N/A        | Ramp Length RT (in)           | 92   |
| Yes        | Ramp Width LT (in)            | 53         | Yes        | Ramp Width RT (in)            | 54   |
| Yes        | Ramp Run Slope LT (%)         | 7.3        | Yes        | Ramp Run Slope RT (%)         | 4    |
| Yes        | Ramp Cross Slope LT (%)       | 0.6        | Yes        | Ramp Cross Slope RT (%)       | 0.7  |
| N/A        | Landing Present               | Yes        | No         | DWS Provided                  | No   |
| N/A        | Landing Length (in)           | 54         | N/A        | DWS Contrast                  | N/A  |
| Yes        | Landing Width (in)            | 64         | N/A        | DWS Length (in)               | N/A  |
| No         | Landing Run Slope (%)         | 4.4        | N/A        | DWS Full Width                | N/A  |
| Yes        | Landing Cross Slope (%)       | 0.4        |            | DWS Offset Type               | N/A  |
| N/A        | Landing Movement Obstructed?  | No         | N/A        | DWS Offset Left (in)          | N/A  |
|            | Landing Movement Type         | Curb       | N/A        | DWS Offset Right (in)         | N/A  |
| N/A        | Landing Shared                | No         |            |                               |      |
| N/A        | Clear Space                   | Yes        |            |                               |      |
| N/A        | Clear Space To Crosswalk (in) | 48         |            |                               |      |
| N/A        | Marked Crosswalk 1            | No         | N/A        | Marked Crosswalk 2            | No   |
|            | Crossing 1 Direction          | S          |            | Crossing 2 Direction          | E    |
| N/A        | Marked Crosswalk 1 Width (in) | N/A        |            | Marked Crosswalk 2 Width (in) | N/A  |
| N/A        | Ramp Inside Crosswalk 1       | N/A        | N/A        | Ramp Inside Crosswalk 2       | N/A  |
|            | Crossing 1 Slope (%)          | 2.2        |            | Crossing 2 Slope (%)          | 2.3  |
|            | Crossing 1 Cross Slope (%)    | 0.2        |            | Crossing 2 Cross Slope (%)    | 0.9  |
| No         | Gutter Ponding                | Yes        | Yes        | Curb Slope                    | 0.2  |
| Yes        | Gutter Lip Height (in)        | 0          |            | Road Run Slope (%)            | 0.4  |
| No         | Gutter Run Slope (%)          | 8          |            | Road Cross Slope (%)          | 1.2  |
| Yes        | Gutter Cross Slope (%)        | 0.1        | No         | Perpendicular Joint Present   | No   |
| Yes        | Overall Surface Condition     | Acceptable |            |                               |      |
|            | Cross Gutter Present?         | No         |            | Spandrel Present?             | No   |
|            | Replace Cross Gutter?         | N/A        |            | Replace Spandrel?             | N/A  |

