




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: BLUEWING_LN **Cross Street:** DUSKYWING_CT **Location:** NE

ADA ID: RPAT211029130548 **Ramp Type:** Type 4 - Parallel **Initial Pass/Fail:** Pass **Overall Compliance:** No **Severity Score:** 15

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

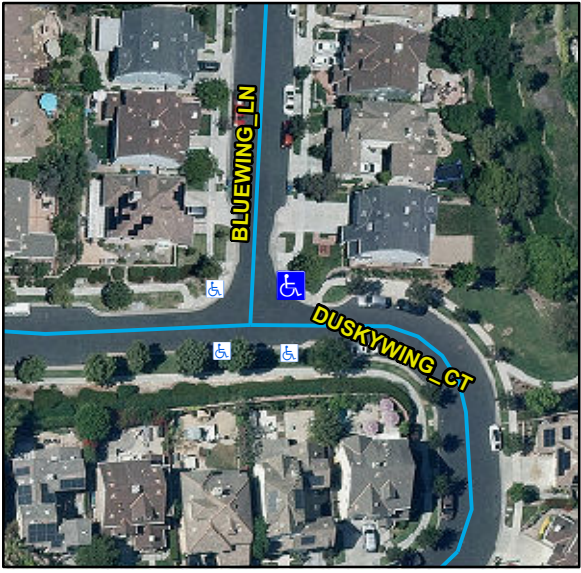

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:
 N/A

OC Std/PROW:
R304.2.2, R204.3, R305, R304.5.4, STD 1115

Total Cost: \$ 4252

Parcel ID Number: 741-131-18
Ramp Island Or Median: None
Ramp Orientation: Diag
Google Street View Link:
http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.54431306,-117.63452609

Street 1 Name: BLUEWING_LN
Stop Condition-Street 1: NoControl
Street 2 Name: DUSKYWING_CT
Stop Condition-Street 2: NoControl

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	101	N/A	Ramp Length RT (in)	93
Yes	Ramp Width LT (in)	52	Yes	Ramp Width RT (in)	53
Yes	Ramp Run Slope LT (%)	4.1	Yes	Ramp Run Slope RT (%)	6.3
Yes	Ramp Cross Slope LT (%)	1.6	Yes	Ramp Cross Slope RT (%)	0.5
N/A	Landing Present	Yes	No	DWS Provided	No
N/A	Landing Length (in)	52	N/A	DWS Contrast	N/A
Yes	Landing Width (in)	58	N/A	DWS Length (in)	N/A
Yes	Landing Run Slope (%)	0.6	N/A	DWS Full Width	N/A
Yes	Landing Cross Slope (%)	1.4		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
N/A	Marked Crosswalk 1 Width (in)	N/A	N/A	Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	1.7		Crossing 2 Slope (%)	0.4
	Crossing 1 Cross Slope (%)	1.1		Crossing 2 Cross Slope (%)	0.6
Yes	Gutter Ponding	No	No	Curb Slope	13.3
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1
No	Gutter Run Slope (%)	10.8		Road Cross Slope (%)	0.5
Yes	Gutter Cross Slope (%)	0.5	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

