




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: TERRASTAR_LN		Cross Street: BROOKWOOD_ST		Location:	W
ADA ID: RPAT211101094727	Ramp Type: Type 4 - Parallel	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score:	10

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
---	--	---	--

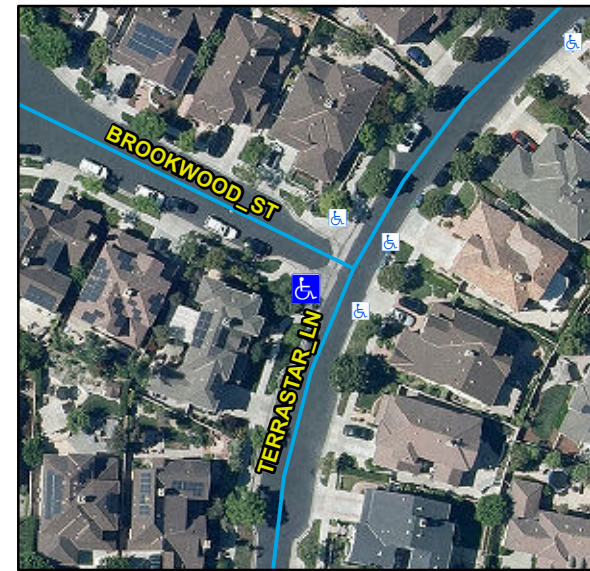

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R305, STD 1115


Total Cost: \$ 4000

Parcel ID Number	759-452-32	Street 1 Name	TERRASTAR_LN
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	BROOKWOOD_ST
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55739385,-117.63471795

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

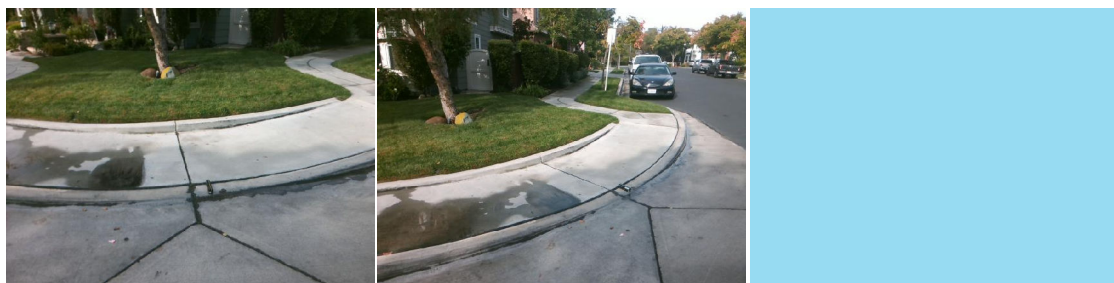

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	110	N/A	Ramp Length RT (in)	117
Yes	Ramp Width LT (in)	53	Yes	Ramp Width RT (in)	53
Yes	Ramp Run Slope LT (%)	0.4	Yes	Ramp Run Slope RT (%)	6.9
Yes	Ramp Cross Slope LT (%)	0.9	Yes	Ramp Cross Slope RT (%)	1.4
N/A	Landing Present	Yes	No	DWS Provided	No
N/A	Landing Length (in)	54	N/A	DWS Contrast	N/A
Yes	Landing Width (in)	50	N/A	DWS Length (in)	N/A
Yes	Landing Run Slope (%)	0.5	N/A	DWS Full Width	N/A
Yes	Landing Cross Slope (%)	1.2		DWS Offset Type	N/A
N/A	Landing Movement Obstructed?	No	N/A	DWS Offset Left (in)	N/A
	Landing Movement Type	Curb	N/A	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SE		Crossing 2 Direction	NE
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	2.6		Crossing 2 Slope (%)	1.8
	Crossing 1 Cross Slope (%)	2		Crossing 2 Cross Slope (%)	2.4
Yes	Gutter Ponding	No	Yes	Curb Slope	3.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	3.4
Yes	Gutter Run Slope (%)	1.8		Road Cross Slope (%)	0.9
Yes	Gutter Cross Slope (%)	2.8	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No