




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: TETHER_MOON_LN Cross Street: TERRASTAR_LN Location: SE

ADA ID: RPAT211101095718 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 6

Codes/Mitigation Info/Possible Solution Field Measurements/Component Compliance

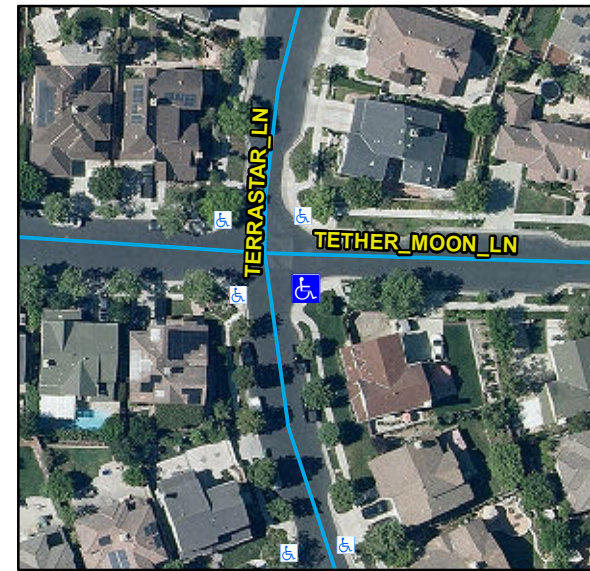

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R204.3, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.5.4, STD 1115

Total Cost: \$ 4252

Parcel ID Number 759-552-50
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

Street 1 Name TETHER_MOON_LN
Stop Condition-Street 1 NoControl
Street 2 Name TERRASTAR_LN
Stop Condition-Street 2 NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55680112,-117.6346974

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	100	N/A	Ramp Length RT (in)	101
Yes	Ramp Width LT (in)	53	Yes	Ramp Width RT (in)	53
Yes	Ramp Run Slope LT (%)	8	Yes	Ramp Run Slope RT (%)	1.5
Yes	Ramp Cross Slope LT (%)	1.6	Yes	Ramp Cross Slope RT (%)	0.9
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	53	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	54	Yes	DWS Length (in)	36
No	Landing Run Slope (%)	3.1	Yes	DWS Full Width	Yes
No	Landing Cross Slope (%)	2.2		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	1
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.5		Crossing 2 Slope (%)	1.2
	Crossing 1 Cross Slope (%)	1.1		Crossing 2 Cross Slope (%)	3.5
Yes	Gutter Ponding	No	Yes	Curb Slope	4.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.4
No	Gutter Run Slope (%)	11.7		Road Cross Slope (%)	2.2
Yes	Gutter Cross Slope (%)	2	No	Perpendicular Joint Present	No
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A