



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: SNAPDRAGON_ST Cross Street: SWEET_PEA_ST Location: SW

ADA ID: RPAT211101130354 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

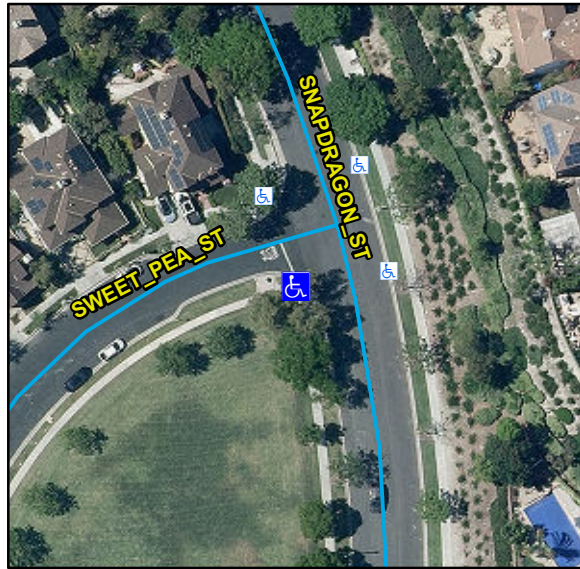

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R204.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305, R304.5.4, STD 1115

Total Cost: \$ 6412

Parcel ID Number 759-553-01
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.55743823,-117.6333601

Street 1 Name SNAPDRAGON_ST
Stop Condition-Street 1 NoControl
Street 2 Name SWEET_PEA_ST
Stop Condition-Street 2 StopSign

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	87	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	3.3	N/A	Flare Slope LT (%)	4.5
Yes	Ramp Cross Slope (%)	0.4	N/A	Flare Traversable LT	No
N/A	Landing Present	No	N/A	Flare Type RT	
N/A	Landing Length (in)	N/A			Sloped
No	Landing Width (in)	N/A	N/A	Flare Slope RT (%)	3.7
No	Landing Run Slope (%)	N/A	N/A	Flare Traversable RT	No
No	Landing Cross Slope (%)	N/A	No	DWS Provided	No
N/A	Landing Movement Obstructed?	Yes	N/A	DWS Contrast	N/A
	Landing Movement Type	Curb	N/A	DWS Length (in)	N/A
N/A	Landing Shared	N/A	N/A	DWS Full Width	N/A
N/A	Clear Space	Yes	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	48	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	E		Crossing 2 Direction	N
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.9		Crossing 2 Slope (%)	2
	Crossing 1 Cross Slope (%)	1.8		Crossing 2 Cross Slope (%)	2.5
Yes	Gutter Ponding	No	No	Curb Slope	11.5
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.4
No	Gutter Run Slope (%)	8.2		Road Cross Slope (%)	4.1
Yes	Gutter Cross Slope (%)	1.6			
Yes	Overall Surface Condition: Acceptable		No	Perp Joint Present	No
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

