



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: GILBERT_ST Cross Street: HARLE_AVE Location: NE

ADA ID: RPAT211122120230 Ramp Type: Type 4 - Parallel Initial Pass/Fail: Pass Overall Compliance: Yes Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

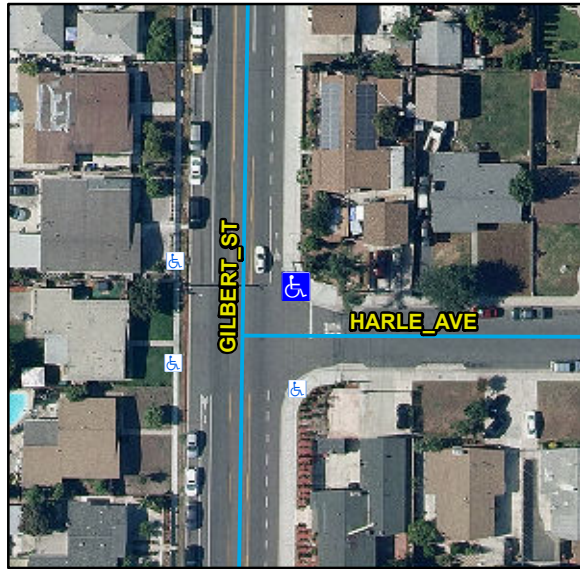

Possible Solutions:

N/A

Surveyor Notes:

N/A

OC Std/PROW:

N/A

Total Cost:

\$ 0

Parcel ID Number 127-501-15
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

Street 1 Name GILBERT_ST
Stop Condition-Street 1 NoControl
Street 2 Name HARLE_AVE
Stop Condition-Street 2 StopSign

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.80966149,-117.96749702

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	93	N/A	Ramp Length RT (in)	91
Yes	Ramp Width LT (in)	100	Yes	Ramp Width RT (in)	112
Yes	Ramp Run Slope LT (%)	6.3	Yes	Ramp Run Slope RT (%)	6.1
Yes	Ramp Cross Slope LT (%)	0.4	Yes	Ramp Cross Slope RT (%)	0.2
N/A	Landing Present	Yes	Yes	DWS Provided	Yes
N/A	Landing Length (in)	108	Yes	DWS Contrast	Yes
Yes	Landing Width (in)	48	Yes	DWS Length (in)	36
Yes	Landing Run Slope (%)	1.3	Yes	DWS Full Width	Yes
Yes	Landing Cross Slope (%)	0.2		DWS Offset Type	Single
N/A	Landing Movement Obstructed?	No	Yes	DWS Offset Left (in)	0
	Landing Movement Type	Curb	Yes	DWS Offset Right (in)	N/A
N/A	Landing Shared	No			
N/A	Clear Space	Yes			
N/A	Clear Space To Crosswalk (in)	48			
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	W		Crossing 2 Direction	S
N/A	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	N/A	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	3.7		Crossing 2 Slope (%)	2.4
	Crossing 1 Cross Slope (%)	0.4		Crossing 2 Cross Slope (%)	0.8
Yes	Gutter Ponding	No	Yes	Curb Slope	7.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.5
Yes	Gutter Run Slope (%)	4.3		Road Cross Slope (%)	3
Yes	Gutter Cross Slope (%)	1.9	Yes	Perpendicular Joint Present	Yes
Yes	Overall Surface Condition	Acceptable			
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

