



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: SHAKESPEARE_DR Cross Street: FOSTER_RD Location: N

ADA ID: RPAT211202100240 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: Yes Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

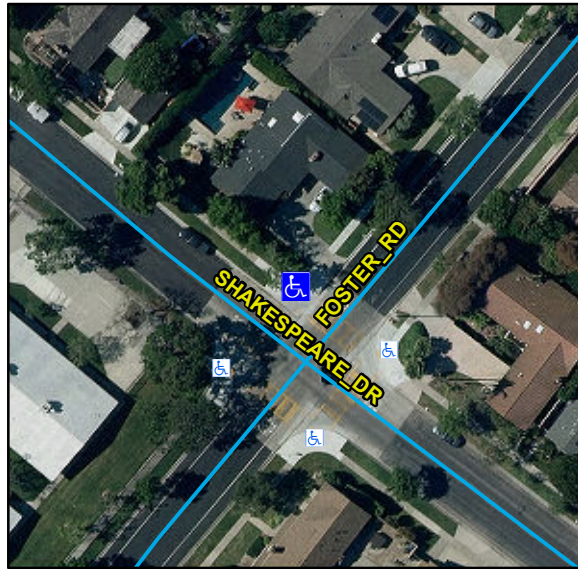

Possible Solutions:

N/A

Surveyor Notes:

N/A

OC Std/PROW:

N/A

Total Cost:

\$ 0

Parcel ID Number 086-341-01
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79685119,-118.08126401

Street 1 Name SHAKESPEARE_DR
Stop Condition-Street 1 StopSign
Street 2 Name FOSTER_RD
Stop Condition-Street 2 StopSign

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	90	N/A	Flare Type LT	
Yes	Ramp Width (in)	49			Sloped
Yes	Ramp Run Slope (%)	4.6	Yes	Flare Slope LT (%)	4.5
Yes	Ramp Cross Slope (%)	1.9	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	48			Sloped
Yes	Landing Width (in)	49	Yes	Flare Slope RT (%)	3.6
Yes	Landing Run Slope (%)	1.5	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	0	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	No	Yes	DWS Contrast	Yes
	Landing Movement Type	N/A	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
Yes	Clear Space	Yes	Yes	DWS Offset Left (in)	0
Yes	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	SW		Crossing 2 Direction	SE
	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	120
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	1.6		Crossing 2 Slope (%)	4.3
	Crossing 1 Cross Slope (%)	0.4		Crossing 2 Cross Slope (%)	0.4
Yes	Gutter Ponding	No	Yes	Curb Slope	0.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.2
Yes	Gutter Run Slope (%)	2.9		Road Cross Slope (%)	3.4
Yes	Gutter Cross Slope (%)	0.8			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

