



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **PIEDMONT_AVE** Cross Street: **ARGYLE_DR** Location: **SE**

ADA ID: **RPAT211206104621** Ramp Type: **Type 1 - Perpendicular** Initial Pass/Fail: **Pass** Overall Compliance: **No** Severity Score: **12**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

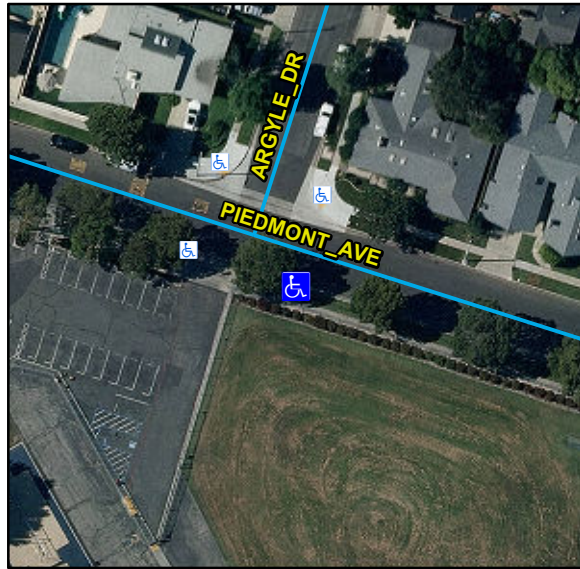

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

Unable to collect gutter info due to mud

OC Std/PROW:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305, R302.7, R304.5.4, R304.5.3, STD 1115

Total Cost: \$ **3332**

Parcel ID Number	086-381-01	Street 1 Name	PIEDMONT_AVE
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	NonDiag	Street 2 Name	ARGYLE_DR
Google Street View Link:		Stop Condition-Street 2	N/A

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79111101,-118.0845719

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	83	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	7.9	N/A	Flare Slope LT (%)	9.2
Yes	Ramp Cross Slope (%)	0.7	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	48			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	10.7
No	Landing Run Slope (%)	3.5	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	0.4	No	DWS Provided	No
N/A	Landing Movement Obstructed?	Yes	N/A	DWS Contrast	N/A
	Landing Movement Type	Fence	N/A	DWS Length (in)	N/A
N/A	Landing Shared	No	N/A	DWS Full Width	N/A
N/A	Clear Space	N/A	N/A	DWS Offset Left (in)	N/A
N/A	Clear Space To Crosswalk (in)	N/A	N/A	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	NE		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	4.4		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	0.6		Crossing 2 Cross Slope (%)	N/A
No	Gutter Ponding	Yes	N/A	Curb Slope	-9999
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	-9999		Road Cross Slope (%)	N/A
No	Gutter Cross Slope (%)	-9999			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	No		Spandrel Present?	No
	Replace Cross Gutter?	N/A		Replace Spandrel?	N/A

