



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: **PIEDMONT_AVE** Cross Street: **WEMBLEY_RD** Location: **S**

ADA ID: **RPAT211206112752** Ramp Type: **Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass** Overall Compliance: **No** Severity Score: **0**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

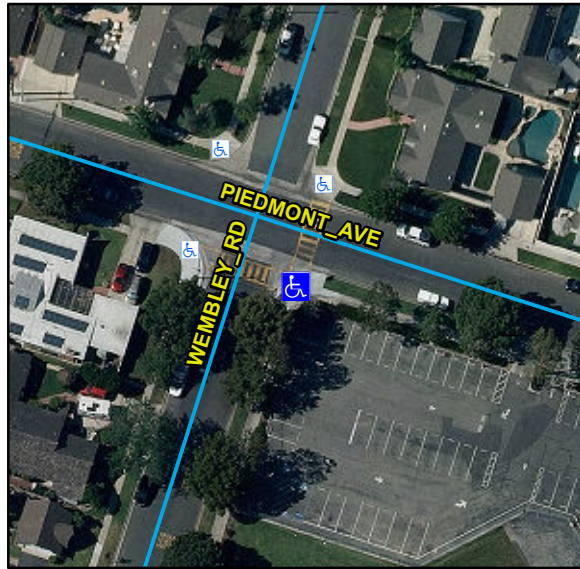

Possible Solutions:

Remove & Replace Landing.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.1, STD 1115

Total Cost: \$ **531**

Parcel ID Number **086-381-01**

Ramp Island Or Median **None**

Ramp Orientation **Diag**

Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.7913062,-118.08545804

Street 1 Name **PIEDMONT_AVE**

Stop Condition-Street 1 **YieldSign**

Street 2 Name **WEMBLEY_RD**

Stop Condition-Street 2 **YieldSign**

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	83	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	7.2	N/A	Flare Slope LT (%)	5.7
Yes	Ramp Cross Slope (%)	1	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	48			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	5.2
Yes	Landing Run Slope (%)	1.1	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	0.1	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	fence	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
Yes	Clear Space	Yes	Yes	DWS Offset Left (in)	0
Yes	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	Yes
	Crossing 1 Direction	NE		Crossing 2 Direction	NW
	Marked Crosswalk 1 Width (in)	120		Marked Crosswalk 2 Width (in)	120
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	Yes
	Crossing 1 Slope (%)	4.2		Crossing 2 Slope (%)	2.3
	Crossing 1 Cross Slope (%)	0.5		Crossing 2 Cross Slope (%)	0.3
Yes	Gutter Ponding	No	Yes	Curb Slope	0.4
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	0.2
Yes	Gutter Run Slope (%)	0.8		Road Cross Slope (%)	2.8
Yes	Gutter Cross Slope (%)	0.4			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

