




Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: FOSTER_RD		Cross Street: PIEDMONT_AVE		Location:	W
ADA ID: RPAT211206113418	Ramp Type:Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass		Overall Compliance: No	Severity Score:	0
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		

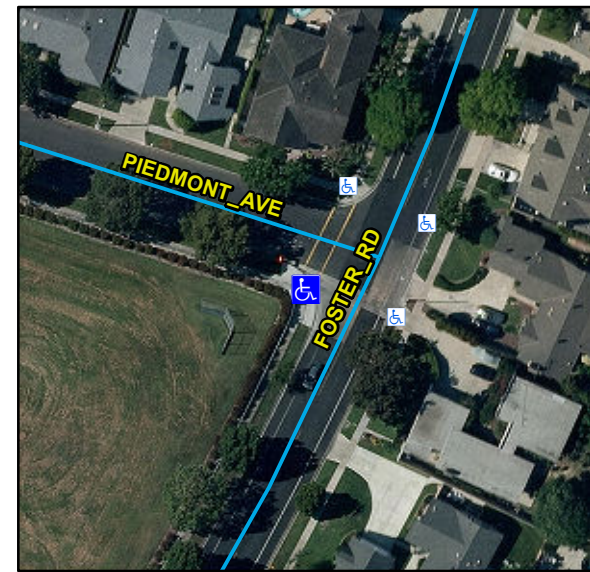

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R302.7, STD 1115

Total Cost: \$ 6160

Parcel ID Number	086-381-01	Street 1 Name	FOSTER_RD
Ramp Island Or Median	None	Stop Condition-Street 1	NoControl
Ramp Orientation	Diag	Street 2 Name	PIEDMONT_AVE
Google Street View Link:		Stop Condition-Street 2	NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.79092448,-118.08392313

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A



Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	79	N/A	Flare Type LT	
Yes	Ramp Width (in)	49			Sloped
Yes	Ramp Run Slope (%)	6.9	N/A	Flare Slope LT (%)	3.3
Yes	Ramp Cross Slope (%)	0.3	N/A	Flare Traversable LT	No
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	48			Sloped
Yes	Landing Width (in)	49	N/A	Flare Slope RT (%)	5.8
No	Landing Run Slope (%)	2.3	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	0.3	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	fence	Yes	DWS Length (in)	36
N/A	Landing Shared	No	Yes	DWS Full Width	Yes
N/A	Clear Space	Yes	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	SE		Crossing 2 Direction	NE
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	0.3		Crossing 2 Slope (%)	3.5
	Crossing 1 Cross Slope (%)	0.9		Crossing 2 Cross Slope (%)	0
No	Gutter Ponding	Yes	No	Curb Slope	6.2
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.6
Yes	Gutter Run Slope (%)	3.2		Road Cross Slope (%)	1.1
Yes	Gutter Cross Slope (%)	0.7			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No