



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: DUNTON_AVE Cross Street: DELL_ST Location: NW

ADA ID: RPAT220126131103 Ramp Type: Type 1 - Perpendicular Diagonal Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 22

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

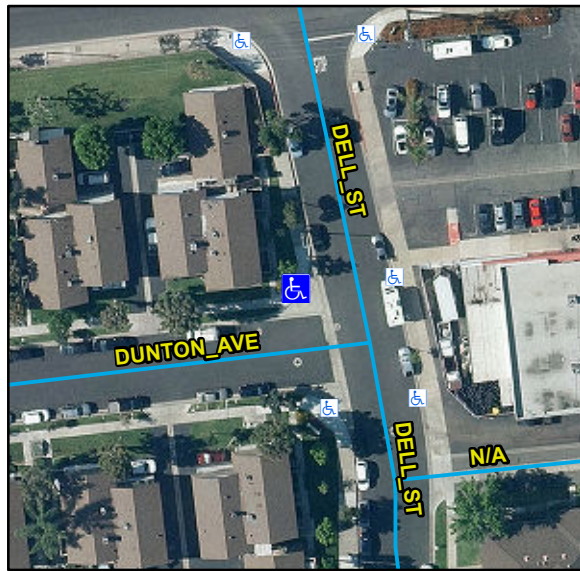

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R302.7, R304.2.1, R304.5.4, STD 1115

Total Cost: \$ 6412

Parcel ID Number 374-272-30
Ramp Island Or Median None
Ramp Orientation Diag
Google Street View Link:

Street 1 Name DUNTON_AVE
Stop Condition-Street 1 NoControl
Street 2 Name DELL_ST
Stop Condition-Street 2 NoControl

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.83454547,-117.85779866

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	41	N/A	Flare Type LT	
Yes	Ramp Width (in)	48			Sloped
Yes	Ramp Run Slope (%)	3.9	Yes	Flare Slope LT (%)	3.6
Yes	Ramp Cross Slope (%)	1.7	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	50			Sloped
Yes	Landing Width (in)	48	N/A	Flare Slope RT (%)	4.4
Yes	Landing Run Slope (%)	0.6	N/A	Flare Traversable RT	No
Yes	Landing Cross Slope (%)	1.3	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	38
N/A	Landing Shared	Yes	Yes	DWS Full Width	Yes
N/A	Clear Space	Yes	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	48	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	No	N/A	Marked Crosswalk 2	No
	Crossing 1 Direction	S		Crossing 2 Direction	E
	Marked Crosswalk 1 Width (in)	N/A		Marked Crosswalk 2 Width (in)	N/A
N/A	Ramp Inside Crosswalk 1	N/A	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	1.7		Crossing 2 Slope (%)	2.2
	Crossing 1 Cross Slope (%)	0.6		Crossing 2 Cross Slope (%)	0.5
Yes	Gutter Ponding	No	No	Curb Slope	9.7
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	1.1
No	Gutter Run Slope (%)	5.1		Road Cross Slope (%)	4
Yes	Gutter Cross Slope (%)	0.9			
No	Overall Surface Condition:	Poor	Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

