



Access Compliance Report Public Rights-of-Way (Curb Ramps)




Main Street: OLIVE_AVE Cross Street: ORANGE_OLIVE_RD Location: E

ADA ID: RPAT220127121939 Ramp Type:Type 1 - Perpendicular Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 9

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

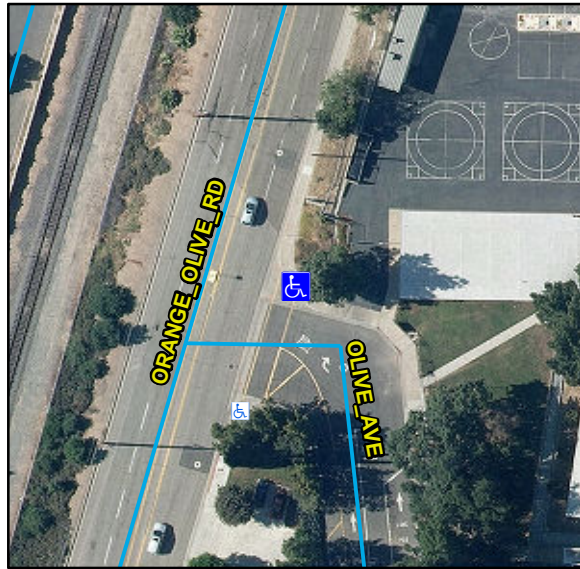

Possible Solutions:

Remove & Replace Entire Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

OC Std/PROW:

R304.2.2, R304.2.1, R304.5.4, STD 1115

Total Cost: \$ 3332

Parcel ID Number 360-401-02
Ramp Island Or Median None
Ramp Orientation NonDiag
Google Street View Link:

http://www.google.com/maps/@?api=1&map_action=pano&viewpoint=33.83979086,-117.84493436

Street 1 Name OLIVE_AVE
Stop Condition-Street 1 StopSign
Street 2 Name ORANGE_OLIVE_RD
Stop Condition-Street 2 N/A

Obstruction and Utility Measurement/Component Compliance

Compliance	Description	Data	Compliance	Description	Data
Yes	Obstructions Present?	No	N/A	Utilities Present?	No
	Obstruction Types	N/A		Utility Types	
	Obstruction Dimensions	N/A			N/A

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48	N/A	Flare Type LT	
Yes	Ramp Width (in)	50			Sloped
Yes	Ramp Run Slope (%)	7.7	Yes	Flare Slope LT (%)	3.4
Yes	Ramp Cross Slope (%)	0.6	N/A	Flare Traversable LT	Yes
N/A	Landing Present	Yes	N/A	Flare Type RT	
N/A	Landing Length (in)	47			Sloped
Yes	Landing Width (in)	50	Yes	Flare Slope RT (%)	5.4
Yes	Landing Run Slope (%)	0.6	N/A	Flare Traversable RT	Yes
Yes	Landing Cross Slope (%)	0.8	Yes	DWS Provided	Yes
N/A	Landing Movement Obstructed?	Yes	Yes	DWS Contrast	Yes
	Landing Movement Type	Curb	Yes	DWS Length (in)	39
N/A	Landing Shared	Yes	Yes	DWS Full Width	Yes
N/A	Clear Space	N/A	Yes	DWS Offset Left (in)	0
N/A	Clear Space To Crosswalk (in)	N/A	Yes	DWS Offset Right (in)	N/A
N/A	Marked Crosswalk 1	Yes	N/A	Marked Crosswalk 2	N/A
	Crossing 1 Direction	SW		Crossing 2 Direction	N/A
	Marked Crosswalk 1 Width (in)	118		Marked Crosswalk 2 Width (in)	N/A
Yes	Ramp Inside Crosswalk 1	Yes	Yes	Ramp Inside Crosswalk 2	N/A
	Crossing 1 Slope (%)	5.7		Crossing 2 Slope (%)	N/A
	Crossing 1 Cross Slope (%)	1.7		Crossing 2 Cross Slope (%)	N/A
Yes	Gutter Ponding	No	No	Curb Slope	10.1
Yes	Gutter Lip Height (in)	0		Road Run Slope (%)	N/A
No	Gutter Run Slope (%)	9.7		Road Cross Slope (%)	N/A
Yes	Gutter Cross Slope (%)	0.5			
Yes	Overall Surface Condition: Acceptable		Yes	Perp Joint Present	Yes
	Cross Gutter Present?	Yes		Spandrel Present?	Yes
	Replace Cross Gutter?	No		Replace Spandrel?	No

